WAR DAMAGE

TO

BRITISH NAVAL VESSELS

SUMMARY OF DAMAGE BY BOMBS TO SEPTEMBER 2, 1941

F7-2/20

July 22, 1942

Preliminary Design Branch Bureau of Ships Navy Department

NOTE: *Indicates Admiralty Report Available in Navy Department

BOMB DAMAGE TO BRITISH NAVAL VESSELS

INTRODUCTORY NOTES

This is the fourth and final summary of war damage to British naval vessels. The preceding summaries have dealt with gunfire, mine and torpedo damage. Supplemental summaries will be issued later as information becomes available and opportunity offers.

This summary is complete from the British entry into the war up to September 2, 1941.

The destroyer section is divided, for convenience, into three groups: Major damage, minor damage and losses. The demarcation between major and minor damage is indistinct and there are a number of borderline cases. Material damages rather than impairment of fighting efficiency has been the criterion used.

The bomb sizes given in the tables are estimated sizes, quoted from British reports. In most cases the basis for these estimates is not stated.

Abbreviations: D.A. ----- delayed-action (applied to bomb fuses)
Inst. fuse --- instantaneous, or direct-action fuse.
A.P. ----- armor-piercing

NOTE: *Indicates Admiralty Report on file Ship Protection Section, Preliminary Design. Bureau of Ships.

Battleships & Battle Cruisers			:No.,Weight & :Type Bomb	: Time out of Action	: Remarks on Damage	: British Notes
H00D 1918 42100 Tons	:Sept.26; : 1939 :	:Not re- : ported :	: Not re- : ported :	None	:Minor damage to plating at :top of bulge, port side. :Compartment flooded in vi- :cinity of damage. Armor un- :damaged and fighting effi- :ciency not impaired.	:
IRON DUKE 1912 (Demilitarized 1931-32)	:0ct.17, : 1939 : :		: 2-500# : (est.) : D.A. fuse :	: Ship : Beached :	:While at anchor Scapa Flow :near misses caused flooding :of "C" boiler room, and "Q" :and "Y" magazines. Ship :beached. All compartments :aft of "B" boiler room :flooded subsequently.	: Vessel had been : demilitarized. : (Belt armor etc. : had been removed.) :
IRON DUKE	:Mar.16, : 1940 :		:2 of unknown size. D.A. :fuse.	: Ship : Beached : :	:Near misses caused slight :buckling of side plating in :way of bilge keel.	: Ship now aground at all tides and used asaccommodation ship and supplementary defense unit for Scapa.
*RODNEY 1925 33900 Tons	:April 9 : 1940 :	:88-dive	:1-1100# :(possibly :2200#) Semi- :A.P. 20" :diam., walls :about 2" :thick :	:	:While operating off Norwe- :gian coast received direct :hit on deck port side a- :breast stack. Bomb decend- :ed at angle of 40° to 45° :from forward after release :of about 1000'. Bomb pene- :trated superstructure, main :and 2nd decks, but was :broken up by 4 1/4" 3rd :deck with low order detona- ;tion. Hole in armor about	: : :

CAPITAL SHIPS

Battleships & Battle Cruisers	: Date		:No . Weight :Type Bomb	&: Time out of Action	: Remarks on Damage	: British Notes
*RODNEY (Cont'd)	: :	:	:	: : :	:1'-5"xl'-1". Blast and splinter effects small. :There was no fire.	: :
*RESOLUTION 1915 29150 Tons	:May 16, : 1940 : : : : : : :	:planes,	: É	'' :	:At anchor off Norway. Hit :on main deck starboard be- :tween "X" and "Y" turrets. :Penetrated main, 2nd and :3rd decks (Med. Steel) and :burst on sloping protective :deck (80# H.T. steel). :Hole in protective deck :4'x3'. Structural damage :not severe repairs being :accomplished by ships :force. Rush of gases and :flame caused casualties on :second deck. Small fires :started in clothing and :bedding in Marines' mess :space. Fire also occurred :in spare armature store :room.	
WARSPITE 1913 30600 Tons	:July 8, : 1940 :		: 1-Est. 25 : Inst. fus		:Attacked in Mediterranean. :Near miss on port side :near #2-4" mount caused :minor structural damage, :mainly splinter effect.	: : :

CAPITAL SHIPS

Battleships & Battle Cruiser			:No.,Weight { :Type Bomb	tof Action:	•	: : British Notes
WARSPITE	July 12	.:Not re-	:1-Est. 100#	: 2 davs	:Attacked in Mediterranean	•
	: 1940		:Inst. fuse	:	:near miss starboard side	•
1913	:	· pon con	:	:	:amidships. Minor structur-	•
30600 Tons	•	:	:	:	:al damage mainly caused by	•
• • • • • • • • • • • • • • • • • • • •	:	:		:	:splinters. No effect on	•
	•	:	:	•	:fighting efficiency and	•
	:	•	•	•	ship remained in service	•
	:	:	:	:	until August 9, 1940.	:
*PRINCE OF WALES	:Aug. 31 : 1940	:Horizon-	v:1-Est. 250#	:construc-	:During raid a bomb appar- :ently fell in water be-	: To prevent recurrence, : check was made each nigh
1070	:	_	itype con-		tween ship and basin wall.	: to see that all man-
1939	•	:level	taining:		:Ship's side aft indented	: holes were replaced,
35000 Tons		:bombing	:about 30#		:about 1'-9", seams opened	: all valves closed and
	:	•	explosive.		and rivets pulled out per-	: D-G holes, etc.,
	:	•		:tion.	:mitting flooding of spaces	: plugged.
	:	:	•	•	inboard. Flooding became	:
	:	•	•		extensive owing to fact	:
	:	•	:	:	:that manhole covers, etc.	:
	•	•	•	•	were not in place. Ship	:
	•	•	•	•	:took a list of 80 before	:
	•	•	•	•	:flooding came under control	•
	•	•	•	•	of shore operated pumps.	:
RENOWN	:Sept.24	,: 40	: Unknown	: None	:Near misses. Fighting	:
	: 1940	: French	•	•	efficiency not impaired.	:
1916	:	:Aircraft	; :	:	:	:
32000 Tons	:	:	:	:	:	:

CAPITAL SHIPS

Battleships & Battle Cruiser	: s: Date		:No.,Weight &: ': :Type Bomb :o:	Time out f Action	: Remarks on Damage	: : British Notes
WARSPITE 1913 30600 Tons	:Jan. 10, : 1941 :	: Not re- : ported	: Unknown :	•••••	:Near miss abreast star- :board hawsepipe; minor :structural damage.	: : :
*WARSPITE 1913 30600 Tons	:May 22, : 1941 :	:3Mess. :109 in :dive :attack : at :about :20-30 :degrees :from ht :of 800 : ft.	:hit, two :(:misses (not : :very near). : :Est. 560 lb.: :(250 Kg)type: :D.A. fuse. : :	4 in	:Bomb perforated main deck :and detonated on second :deck, blowing off portions :of main deck and 60-lb. :side plating. Hole 6'xl2' :blown in second deck, two :courses, 3/4" plus 1 1/4" :H.T. Twin 4" AA mount :blown overboard. Engines :and main armament undamaged. : Considered inadvisable :to fire forward turrets. :No.3 boiler room out of :action due to damaged fan.	Example of severe damages caused by D.A. bombs bursting within the ship.
VALIANT 1914 30600 Tons	:May 22, : 1941 :	: High :level :attacks :	: 2-50 Kg :direct hits: .:2-50 Kg near: :misses. D.A.: :fuses.	None	:Direct hits on main deck: :minor structural and :splinter damage. Near :misses: minor structural :damage to blister.	: :

attleships & Battle Cruiser	: s: Date	: Attack : by	:No.,Weight 8	k: Time out of Action	Remarks on Damage	: British Notes
BARHAM	:May 27,	:Not re-	: 1-250 Kg :direct hit	:2 months	:In Mediteranean. Direct :hit penetrated 5"STS roof	:
1914	• 1941	· por tea	: 1-250 Kg	:	of "Y" turret. Cordite	:
31100 Tons	•	: :(est.) near : :fires in gun house quickly	t			
72200 10110	•	:	miss. D.A.		under control, but cables damaged by fire. Near miss	:
	:	:	:fuses.	:		:
	:	:	:	:	:port side forward holed	:
	:	:	:	:	and distorted blister over	:
	:	:	:	:	:area 16'x20'.	
WARSPITE	:June 23	.:Not re-	:1 D.A. fuse	:See dam-	:Near miss at Alexandria	:
HIGH III	: 1941	: ported	:1000 lb.	:age of	:while undergoing temporary	:
1913	:	:	:Near Miss	:May 22,	repairs after attack of:	:
30600 Tons	:	:	:	: 1941	:May 22, 1941. Minor damage	:
	:	:	:	:	to starboard upper and	•
•	:	:	:	:	:lower bulges. Both were	:
	:	:	:	:	crushed by the shock.	:

AIRCRAFT CARRIERS

Name of Ship	: Date	: Attack : by	:No.,Weight & :Type Bomb	: Time out :of Action	: Remarks on Damage	: : British Notes
FURIOUS	:April 16	: Not re-	: 2-250 lbs.	: 4 days	:Off Norway. Bombs missed	:
	: 1940		:D.A. fuses.		:about 15 yards abreast	:
1916	:	:	:Near misses	:	:flight deck, to port.	:
22450 Tons	:	:	•	:	:Blades of starboard inner	:
	•	:	:	:	:H.P. turbine cracked put-	:
	:	:	•	:	:ting shaft out of action.	:
*ILLUSTRIOUS	:Jan. 10,	: Dive	: 6 hits, 3	:10 months	:Escorting convoy in Medi-	: Secondary positions
	: 1941	: bombed	:near misses	:(6 in	:terranean.	: for hangar sprink-
1939	:	:by Ju	:250 to 500	: U.S.A.)	•	: ling are required.
23000 Tons	:	:87's	:Kg., British	n:	:1. Direct hit on pom-pom	:Scuppers in hangar
•	:	from	:est. See	;	:platform, overhanging side;	:should have guards
	:	:12000',	:note below	:	:ricocheted from top of armor	:to prevent their being
	:	:releas-	and remarks	:	:belt and into water; pro-	:choked with debris.
	:	ing at	:opposite.	:	:bably no explosion. Est. 500	
	:	:1500 to	:	:	:Kg.	:gear should be provided
	:	:800 ft.	:	:	:	:Steel hangar fire
	:	:High		:	:2. Direct hit on extreme	curtains should be:
	:	:level	:	:	:edge of flight deck; bomb	replaced by fabric
	:	:attack	: No hits	:	:passed through side under	:(asbestos). Improved
	:	:from	*	•	:overhang and burst about	:arrangements should
	:	:14000'.	•	:	:10 ft. above the water.	:be provided for
	:	:Dive	:1 hit, 2	- :	:Extensive fragment damage	:fighting fires in the
	:	:bombed	near	:	:to shell; compartments	:overhead stores in
	:	:by 15	:misses.	:	:flooded and fire caused in	:the hangar.
	:	:Ju 87's	:	:	:lamp room, Est. 500 Kg.	: .
	:	:High	:	-	:	:
	:	:level	:	:	:3. Small direct-action bomb	:
	:	:plus	: No hits	:	:struck pom-pom, wrecking it	:
	:	:dive	.	:	and causing minor structur-	:
	•	bombing	.	•	:al damage in vicinity.	:

Name of Ship	: Date	Attack No., Weight by & Type Bomb	Time out of Action		British Notes
*ILLUSTRIOUS (Cont'd.)	:	: :NB: A careful study :of the penetration of :the flight deck, :tests of the armor, .and correlation with :bomb data, indicates	:	:4. Direct hit on after ele- :vator while platform was :down almost a deck height, :which then dropped to the :bottom of the well. Est. :250 Kg., Inst. fuse.	: : : : :
	:	:2000 lbs. as approx. :bomb weight for Hit		: :5. Direct hit in after ele-	:
	:	No. 6. May be 1000 :Kg. 'Esau' or similar :type.	}	vator well penetrated :wrecked platform and hangar :deck and burst just below :this deck, Est. 250 or :500 Kg., D.A. Fuse.	:
•	:	:	:	: :6. Direct hit on flight	:
	:	: :	: :	:deck near centerline about :2/3 ship's length from	:
	: :	:	: :	:bow. British est. 500 Kg., :U.S. est. 1000 Kg.: (See	:
	: :	: :	:	note opposite). Penetrated: 3" armor on flight deck: exploding in hangar close	:
: :	; ;	; ;	:	to hangar deck. Extensive blast and fragment damage;	:
·	:	: :	: :	:fire curtains torn to bits, :forward elevator (up)	:
	:	:	:	:buckled, much damage to :fittings and systems :throughout hangar; fires	:
	; ;	:	:	:started. Hole blown in	:
	:	:	:	:hangar deck with structural	:

AIRCRAFT CARRIERS

ame of Ship	:	Date		Attack by	:No.,! :Type	Weight Bomb	&: Ti	me out: Action:	Remarks o	n Damage	: British Notes
HILUSTRIOUS	:		:		:		:		age extendi	ng three	:
(Cont'd.)	:		:		:		:	:dec	ks below.		•
(0020 41)	:		:		:		:	:			•
	:		:		:		:	:7.	Direct hit;	size not es-	•
	:		:		:		:	:tir	mated; proba	ably D.A. Hit	:
	•		:		:		:			ator well and	•
	:		•		:		:		conated at a		:
	•		•		:		:	:le	rel as No. 5	5 hit. Hits 4,	:
	:		•		•		:	:5 8	and 7 comple	etely wrecked	:
	:		•		•		:	:the	elevator a	and caused very	7:
	:		•		•		•	:ee:	rere structi	ural damage in	:
	•		•		•		:	:the	after 80 1	ft. of the ship):
	•		:		:		•			was blown out	
	•		:		•		:			led by frag-	:
	•		:		•		•	:mei	nts. A numbe	er of fires	:
	•		:				•		eulted.		:
	•		•		: ;	lu _i	•	•		·	:
			•		1		•	.8.	Near misse	s caused minor	:
	:		:		•		•			ight flooding.	
	:		•		•		:			failed. All	*
	:				•		•		rcraft in h		•
	:	•	•		•		•		maged5 de		•
	:		:		:		•			repairable.	•
*ILLUSTRIOUS 1939 23000 Tons	: :	an. 16 1941	5,: :	Di v e Bombine	:Est	. 500 K	Ig.:(S	5) :fo :pl :de	rated fligh oded above ck. Serious	ect hit per- t deck, ex- lower gallery structural and	:
	:		:		:		:		linter dama	ge. Near minor damage.	•
	:		:		:		:	;m1	BREB CHUSEO	mittor, demerse.	•

Name of Ship	: : Date	: Attack : by	:No.,Weight :Type Bomb	&: Time out		: British Notes
*ILLUSTRIOUS	:Jan. 19 : 1941 :	;:Not re- : ported :	:Not re- : ported :Near miss.	:(See page : B6) : :	:At Malta. Near miss port :side caused minor struc- :tural damage but cracked :castings to main and auxi- :liary machinery.	:Ship proceeded to :Alexandria at 23 :knots after temporary repairs.
ARK ROYAL 1937 22000 Tons	:March 2 :1941 :	2:Not re- : ported :	: Unknown :	: None :	:Near miss starboard side :forward; minor structural :damage.	:
FURIOUS 1916 22450 Tons	:April 1 : 1941 :		:Two, detail :unknown. :	s: None	:Ship undergoing repairs at :Belfast. Two near misses; :minor structural damage, :splinters damaged super- :structure and electric :leads.	:
FURIOUS 1916 22450 Tons	:May 5, : 1941 : : : :		:One direct :hit, D.A. :fuse. :Size Unknow :	: 7 days : m:	:At Belfast (see above). :Direct hit on flight deck :penetrated two decks ex- :ploding in lower hangar. :Minor structural damage. :Electric leads and spraying :systems damaged. Fire in :lower hangar - fire cur- :tains destroyed.	:Fighting efficiency :not seriously im- :paired. :
PECASUS 1914 6900 Tons Experimental seaplane carrier	:May 5, : 1941 :	· ·	:One near :miss, Inst. :fuse. Size : Unknown :	: None : (ship : under : repair) :	:Damaged during raid on :Belfast. Near miss, port :side amidships. Side per- :forated by fragments over :full length above W.L. Ex- :tensive minor damage to	:Fighting efficiency :not seriously im- :paired. :

Name of Ship	: Date	: Attack by	:No., Weight &: Time out :Type Bomb :of Action	t: n: Remarks on Damage	: British Notes
TOTA CLIC	•	•		:fittings. Oil leaked over-	:
PEGASUS (Cont'd.)	•	•	:	:board and burned on	•
(conc.a.)	:	:	:	:water.	
	W - 06	. Dimo	•Two direct :6 months	:Attacked off Scarpanto	•
*FORMIDABLE	:May 26,	: Bombers	/	:(Med.). Hit No. 1 struck	:
	: 194 1	:Pomber.a	:Kg. AP bombs: U.S.)	eforward, penetrated about	:
1939	:		:D.A. fuses. :	:28 ft. and detonated below	:
23000 Tons	•	•	.p.A. Tubob.	:hangar deck (did not hit	:
	:	•	•	armored portion of flight	:
	:	•		:deck). Blew hole 52'xl4' in	:
	:	•		shell plating, caused ex-	:
	:	•	•	tensive structural damage	:
		•	•	over a volume of 52' long	:
	•		•	and 4 deck heights. Fires	:
	•	:	•	started were quickly ex-	:
	:	:	•	tinguished. Hit No. 2	•
	:	:	•	struck 'X' gun platform,	•
	:	:		:passed through overhanging	:
	:	:		side and exploded about	:
	:	:		:12 ft. under water. Strut	:
	:	:	•	arm and stern casting frac-	:
	:	:	:	tured, and minor structural	:
	:	:		:damage done to hull	:
	:	:	•	opposite burst. Speed re-	:
	:	:	:	duced to 20 knots in fair	:
	:	:	•	:weather. 'X' gun mount out	:
	:	:	:	of action. Forward elevator	· • •
	:	:		and two forward gun mounts	<u>.</u>
	:	:		could be used only in emer-	. 1
	:	:	•		-
	:	:	:	:gency.	

Name of Ship	: : Date	: Attack : by	:No.,Weight :Type Bomb	: Time out		: : British Notes
AURORA 1936 5270 Tons 6-6" Guns			:Several, :est. 50 and :250 lbs., :all D.A. :fuses.	: None : : :	:North Sea with SHEFFIELD. :Minor damage to 'B' turret :(glancing blow) did not :prevent operation. Several :near misses. Minor struc- :tural damage.	: : : :
SHEFFIELD 1936 9100 Tons 12-6" Guns	:Sept.26, : 1939 :		:Several, :est.50 and :250 lbs., :all D.A. :fuses.	: None : : :	:North Sea with AURORA. Near :miss 20-30 yards abreast :'B' turret put one Asdic :out of action and caused :minor damage to machinery :and electrical equipment.	:Fighting efficiency :unimpaired. :
SOUTHAMPTON 1936 9100 12-6" Guns	:0ct.16, : 1939 : : : : :	:dive	:D.A. fuse.		:Anchored Firth of Forth. :Bomb hit corner of pom-pom :magazine, passed through :three decks at an angle, :went out through the side :and exploded below water. :Minor structural damage. :Electric power failed tem- :porarily. : :	:Splinter protection :must be provided for :exposed personnel. :Circuit breakers :should be locked in. :Starter handles to :L.P. operators to be :tied in the 'on' :position. :Important fuses should :be wired in place to :prevent jumping out :under shock.
EDINBURGH 1938 10000 Tons 12-6" Guns	:0ct.16, : 1939 : : :	:dive :Bombers			:Anchored Firth of Forth. :Two near misses "counter- :mined" a third bomb about :20 ft. above water, 50 ft. :from the starboard side. :Considerable splinter	: : : :

Name of Ship	: : Date		:No.,Weight :Type Bomb	: Time out	_	: British Notes
EDINBURGH (Cont'd.)	: :	: : :	:	: :	:damage; three pierced 5/8" :side plating, many hit :upper works. Minor damage :to electrical equipment.	: : :
COVENTRY 1917 4290 Tons 10-4" AA.	:Jan. 1, : 1940 : :	:Not re- : ported	:Two near :misses, 250- :500 lb. D.A. :fuses.	:(inc.	:Anchored. Both bombs fell: 15-20 ft. to port abreast: No. 6 gun. Slight structural and no splinter damage. Cracked castings in main and auxiliary machinery. Radio out of action.	: : : :
NORFOLK 1928 9925 Tons 8-8" Guns	:Mar.16, : 1940 :	:flight :or :shallow :dive	d:	:	Anchored Scapa Flow. Bomb hit quarterdeck, port side, and passed diagonally through the ship exploding just inboard of the shell at the turn of the bilge on the stbd. side. Severe structural damage; hole 8'xl4' blown in shell. Flooding over about 88' up to waterline. 'X' and 'Y' turrets and steering gear out of action. Probably would be unseaworthy in rough weather, though made 13 knots to the Clyde. Fire followed explosion and 'X' and 'Y' magazines could not be flooded due to jammed operating gear, although it	:doors below the :lower deck should be :stiffened. :Trunks to be fitted :to certain important :compartments (e.g., :to steering gear room).

Name of Ship	: : Date	: Attack : by	:No.,Weight :Type Bomb	: Time out of Action		: : British Notes
*NORFOLK	:	·	:	:	:happened that these spaces	:
(Cont'd.)	•	:	:	:	:flooded automatically due	:
(00110 01)	•	•	:	:	:to damage.	:
	•	•	:	:	:*Telemotor leads cut by	:
	:	:	:	:	:splinters, both sides.	•
CLASCOW 1936	:Apr. 9, : 1940		:Two 500 lb., :both near :miss. One	: 2 days	:Norwegian coast: Both bombs :dropped to port One burst :on impact 15 ft. abreast	:blanked. Air test :plugs to be fitted in
9100 Tone	:	:	:Inst. and	:	:Sta.70, the other under wa-	:lower deck hatches
12-6" Guns :	:	:D.A. fuse.	:	ter forward. Mainly splinter	:(to detect flooding).	
	:	:	:	:	:damage; slight structural	:Quick-setting cement
	:	:	•	:	:damage and minor flooding.	and tongued-and grooved
:	:	:	:	:	:'A' turret temporarily out	:planks to be supplied
	:	:	:	:	of action. Speed reduced for	for damage control.
	:	•	:	:	:half hour due to trim by	:W.T. sluice valves to
	:	:	•	:	:bow.	:be fitted in vent
	:	:	:	:	:	trunks where trunks
	:	:	:	:	:	:pierce lower and plat-
	:	:	:	;	•	:form decks. Additional
	:	:	:	•	:	:welding sets for damage
	:	:	:	:	:	:control parties.
SOUTHAMPTON	:Apr. 9,	:Not re-	:One near	: None	:Minor damage; director	:
	: 1940		:miss, size	:	:temporarily out of action	:
1936	•	:	of bomb not	;	:	:
91.00 Tons	:	:	:estimated.	: .	:	:
12-6" Guns	:	:		:	:	:
PENELOPE	:Apr. 10	,:Not re-	:Four near	;	:Bottom had been previously	:
	: 1940		:misses. Ins	t:	:damaged extensively by	:
1935	:	:	:fuse. Size	:	grounding on submerged rock	:

Name of Ship	: : Date	•	:No.,Weight :Type Bomb	: Time out :of Action		: British Notes
PENELOPE (Cont'd.)	: :	•	<pre>:not estimat- :ed. :</pre>	: :	:off Norway; the bombing :attack was while the ship :was anchored after tempor-	: :
5270 Tons 6-6" Guns	: : :	:	: : :	: : : :	:ary repairs. Four near :misses about 15 yards to :port caused extensive :splinter damage and minor :flooding.	: : :
BERWICK 1926 10000 Tons 8-8" Guns	:April 10 : 1940 :	: Not re- : ported : : : :	:Near misses. :Both Inst. :and D.A. :fuses. No. :and wt. not :est. :	: :	:Bombs exploded under the :bottom abreast sta. 105-117 :port and under the stern :from sta. 262 aft. Slight :structural damage and minor :flooding. Those which detonated on water surface :caused splinter damage to :aircraft and hangar.	: : :
*SUFFOLK 1926 10000 Tons 8-8" Guns	:Apr. 17 : 1940 : : : : : :	:level :and div :bombing :88 bomb :dropped :in 33 :separat	:Direct hit :by 1100 1b. e:(est.), D.A .:fuse. 2 near s:misses, 500 :lb., Inst. :fuse. 1 near e:miss, 500 .:lb., D.A. :fuse.	: :: :	s:Returning from bombardment :of Stavanger Aerodrome, :Norway. Direct hit on main :deck stbd., just forward of :'X' turret, perforated main :second, lower and lst plat- :form decks and exploded :midway between after end of :engine room and forward end :of 'X' turret shell room. :Severe structural and :splinter damage; one small :hole in side; flooding of :after engine room and com- :partments below lower deck :back to 'Y' shell room.	:facilitate locating :and plugging splinter :holes. :Certain air ports be-

ame of Ship	: Date		:No.,Weight :Type Bomb	: Time out of Action	: Remarks on Damage	: : British Notes
SUFFOLK	•	•	:	:	:This put the after engine	:Fog nozzles recom-
(Cont'd.)	•	•	: :	:	room and both after turrets	:mended for fire-
(00110 0.)	•	•	•	:	out of action.	:fighting.
	•	•	•	:	:Two near misses 15'-20'	:Linoleum very slippery
	•	•	•	: :	from stbd. side just aft of	:when wet. Fumes from
	•	•	•	•	:'Y' turret, with Inst.	:linoleum cement caused
	•	•	•	•	:fuses, caused severe splin-	:difficulty.
	•	•	•	•	ter damage. Ship flooded up	:Trunk access from main
	•	•	•	•	:to main deck.	:deck to steering gear
	:	•	•	:	:Near miss 15' abreast after	:being installed. Mag-
	•	•	•	•	:boiler room caused flooding	:azine flooding control
	•	•	•	•	of bulge compartment	:gear jammed.
	•	•	•	•	:(blister) by D.A. fuse.	:
	:	•	•	•	:The near misses put the	: :
	•	•	•	•	steering gear out of action	•
	•	•	•	•	:(control later regained)	•
		•	•	•	and the after end of the	•
	•	•	•	•	ship was abandoned. Speed	•
	:	•	•	•	reduced to 15 knots. Ship	•
	:	•	•	•	:unseaworthy and beached at	•
	:	:	•	•	:Scapa Flow after steaming	•
	:	:	•	•	:22½ hrs. at 15 khots	*
	•		<u>:</u>		:22 III 8. AU I) MICOS	•
	. ^	07.No+ 20	:Near misses	.: None	:Slight structural damage	:Fighting efficiency
EVONSHIRE	-			. HOTTE	due to shock and splinters.	
1.007	: 1940	: portea	:Both inst.	•	:Minor flooding.	•
1927	:	:	:fuses. No.	•	· · · · · · · · · · · · · · · · · · ·	•
9850 Tons	;	•			•	•
8-8" Guns	:	:	and wt. not		•	•
	:	:	:est.	i	•	•

CRUISERS

Name of Ship	: : Date		:No.,Weight :Type Bomb	: Time out		: : British Notes
*CURACOA A. A. Ship 1917 4290 Tons 8-4" Guns	:Apr. 24, : 1940 : : : : : : : : : : :	:high :level :attacks, :8000 to	:One direct :hit 500 lb. :D.A. fuse. :One near :miss, D.A. :fuse, size :not est. :Large no. :fell within :20-50 yds. :of ship. :Some had :very long :delay, up to :12 seconds.		:3 days of bombing off Nor- :way. Near misses prior to :direct hit caused minor :structural damage and leaks :in oil tanks. :Direct hit on port wing of :lower bridge perforated :superstructure deck and ex- :ploded just above fore- :castle deck, causing severe :structural damage. All :bridge controls and communi- :cations out of action. :Two of the tripod mast sup- :ports severely damaged but :alignment remained reason- :ably correct.	:locker bottom blown :off by blast and con- :tents scattered; none :exploded. Pom-pom in :perfect working order :though deck around it :wrecked completely. :Ammunition drum of :quad. 0.5" MG hit; :no rounds exploded:Supply fan sucked :gas into HACP (plot)
1917 4290 Tons 10-4" A.A.	:May : 1940 :		:No details :except D.A. :fuses.		:Near misses strained oil :tanks causing leakage. :	:Fighting efficiency :unimpaired. :
1936 5270 Tons 6-6" Guns.	:May 18, : 1940 :	:Not re- : ported :	:Not reported:	1:4 weeks	:Damage to turrets when off :Norway; details not known. :	: : :

Name of Ship	: : Date		:No ,Weight :Type Bomb	: Time ou :of Action		: : British Notes
CAIRO	:May 25, : 1940 :		:100-200 lb. :near miss, :Inst. fuse.	:	:Superficial splinter damage :antenna and direction :finder aerials shot away by :splinters.	:
SOUTHAMPTON 1936 9100 Tons 12-6" Guns			:100-200 lb. :near misses :Inst. fuse.	:	:Off Norway. Splinter damage :above the waterline; some :damage to superstructure. :	:Fighting efficiency :unimpaired.
CURLEW 1917 4290 Tons A.A.	:May 26, : 1940 :	:Not re- : ported:	:Direct hits : :	: Sunk : :	: : :	
CAIRO 1918 4200 Tons 8-4" A.A.	:May 28, : 1940 :		:Two direct :hits, Inst. :fuses. :	:5 weeks :	:Structural and splinter :damage to bridge and super- :structure; minor damage to :aux. machinery and steam :joints reduced steaming :efficiency.	:
1918 4200 Tons 8-4" A.A.	:June 2, : 1940 : :	:Not re- : ported :	:Not reported:	None:	:Patrolling off Dunkirk, :Fracture in gear case; also :in oil cooler discharge :pipe.	:Fighting efficiency :unimpaired. :

GLOUCESTER 1937 9400 Tons 12-6" Guns.	: 1940 :	:Not re- : ported :	:Direct hit- :no details :		:During attack on Italian :ships. Minor damage to :bridge structure and in- :struments thereon.	: : :
*SUSSEX 1928 9850 Tons 8-8" Guns	:Sept.18, : 1940 : : : : : : : :	Night bomber	:Direct hit, :est. 250 Kg. :D.A. fuse. : : : : : : : : : : : : : : : : : : :	: months	:In basin, Clydeside, after refit. Bomb hit main deck abreast mainmast, pene- ;trated 4 decks in all and exploded in stbd. thrust block compartment. Shell not ruptured, though pierced by fragments. Adipacent oil tank boundaries penetrated releasing oil which caught fire. Both engine rooms on fire as oil spread. Large quantities of water pumped in by local brigades caused ship to heel to 23 degrees and ground; this caused damage to propellers, etc. :Ship seriously damaged from forward engine room to the stern.	:that the fire could :have been confined :to the after engine : room. :Remote control gear :for magazine flooding
*SOUTHAMPTON 1936 9100 Tons 12-6" Guns	:Jan. 11 : 1941 :		:2 or 3 250 :Kg. direct :hits, D.A. :fuse. First :hits had in- :cendiaries :attached to :bombs.	•	:Attacked while escorting :convoy off Malta. Hit just :forward of 'X' turret :caused extensive internal :damage and killed 27 offi- :cers in wardroom. Oil fire :resulted; 'Y' magazine :flooded but operating gear	:No British notes. U. S. :comment based on ob- :server's report follows: :(1) Officers should not ::congregate in same room :at same time. (2) Train- :ing in fire fighting is :essential (NB: British

Name of Ship	: Date		:No.,Weight :Type Bomb	: Time out		: : British Notes
*SOUTHAMPTON	:		•	:	:for 'X' and 4" magazine	and U.S. Navy both now
(Cont'd.)	:	:	:	:	:floods was jammed. Hit on	:have fire fighting
(-3323 347)	:	:	•	:	:port hangar penetrated to	:schools). (3) Special
	:	:	•	:	and exploded on protective	:nozzles on hoses are
	:	:	:	:	:deck, splitting it and	:needed for efficient
	:	:	:	:	:causing fire in 'A' boiler	:use and for protection
	:	:	:	:	:room. Possibly another hit	of personnel (NB: being
	:	:	:	:	aft. All water supply and	:provided in both U.S.
	:	:	:	:	:power lost due to extensive	and H.M. Navies).
	•	:	:	:	:fires; this with loss of	:(4) Another case of
	:	:	:	:	:key personnel, forced aban-	: jammed reach rods to
	:	:	:	:	:donment of ship. She was	:magazine flood gear.
	:	:	:	:	sunk by torpedoes from H.M.	:(5) Holes were cut in
	:	:	:	:	:ships.	the deck to get at
	:	:	:	:	.	:the fires a possible
	:	:	:	:	:	:use for the damage
	:	:	:	:	:	:control party's acetylene
	:	:	:	:	:	:torches in similar cases.
GLOUCESTER	:Jan. 1	l.:Not re-	:Direct hit	:1 month	:Escorting convoy in Medi-	
	: 1941		:by 25 Kg.	:	:terranean. Direct hit	:
1937	:	:	:bomb (dud).	:	:through forward 6" director	:
9400 Tons	:	:	:Near miss,	:	control which damaged	:
12-6" Guns.	:	:	:size not es		:rangefinder; bomb was a dud	.:
	:	:	:Inst. fuse.	:	:Minor damage caused by near	:
	:	:	:	:	:miss fragments.	:
PERTH	:Jan, 1	5,:Not re-	:One near	: None	:Near miss aft while at	:'Y' turret out of
	:1941		:miss. Size		:Malta. Minor structural	action due to shock.
(H.M.A.S.)	:	:	and type un		:damage in way of oil fuel	:
		*	:known		y	

CRUISERS

Name of Ship	: Date		:No.,Weight :Type Bomb	: Time ou :of Action		: : British Notes
PERTH	:	:	:	:	:tanks; minor flooding of	*
(Cont'd.)	:	:	:	:	:'X' shell room and adjacent	.
	:	:	: ,	:	:compartments.	
1934		:	•	:	:	•
6980 Tons	:	:	:	:	:	•
8-6" Guns.	:	:	•	:	:	:
AJAX	:Jan. 24,	:Not re-	:Near miss;	: None	:Three low power generators	:Fighting efficiency
			:no details	:	stripped (apparently refers	not impaired.
1934	:	:	:	:	to some auxiliary machinery).:
6985 Tons	•	:	:	:	:	/** •
8-6" Guns.	:	:	:	:	:	:
NEPTUNE	:Feb. 9,	:Not re-	:On 9th, had	:21 month	s:On 9th, near miss was 20-30	•
	and	: ported	:near miss	:	:ft. to port abreast main-	•
1932	:Feb. 16,		:from 250 Kg	. :	:mast. Minor damage to oil	•
7175 Tons	: 1941	:	:D.A. Bomb.		tanks and radio compart-	•
8-6" Guns.	. :	:	:On 16th, had	1:	ments. On 16th, ship was in	•
	:	:	:near miss:		:dry dock at Chatham. Bomb	•
	:	:	:details of	:	exploded 150 yards away to	•
	:	:	:bomb not es-	-:	:port, on deck side, causing	•
	:	:	:timated.	:	:superficial splinter damage	
BONAVENTURE	:Mar. 23,	:Not re-	:One near	: None	:Damaged during attack on	•
			:miss, size		:Grand Harbor, Malta. Super-	•
1939	:	:	:unknown,	:	:ficial damage by fragments.	
5450 Tons	:	:	:Inst. fuse.	:	:	•
10-5.25" Gu	na	•	•	•	•	•

BOMB DAMAGE CONFIDENTIAL

Name of Ship	: : Date		:No. Weight :Type Bomb	: Time out		: : British Notes
SHEFFIELD 1936 9100 Tons	:Mar. 30, : 1941	:French :dive :bomber	:One near :miss, 250 :Kg., D.A. :fuse.	:5 days :(Inc.rep. :previous :mine	:Near miss 10-15 yds. to :port, forward, Minor damage :to shell and framing below :water.	:Fighting efficiency :not impaired. :
12-6" Guns.	:	:	:	:damage)	:	•
NAIAD 1939 5450 Tons 10-5.25" Gu	: 1941	:Raid on :Tyne :Area	:500 Kg. 250 :Kg. near :misses Inst. :fuse.	:	:Superficial splinter damage :Keeps to sliding feet of :turbines damaged; glass in :F.C. instruments broken; :gyro damaged.	:Modified keeps an :advantage. :Modified magazine :stowage stood shock :well.
KENT 1926 10000 Tons 8-8" Guns		,:Raid on :Plymout	:Direct hit, h:Inst. fuse. :Near miss, :Inst. fuse. :Both 50 Kg.	:(under :repair :at time)	:In dry dock. Direct hit :just abaft 'Y' turret; :minor structural damage. :Extensive but unimportant :splinter damage.	:Fighting efficiency :not impaired. :
YORK 1928 8250 Tons 6-8" Guns.	:Apr.24, :May 5, :May 18, :May 19,	:bombing :of har- :bor pri :to Cret :invasio	:'Remarks' or e:	:Abandoned	i:Bombed at Suda Bay while :beached after torpedo :attack March 26th. : :22 April: Two near misses, :one close aboard and one 75 :yards away, caused re- :flooding of engine room, :previously flooded by :torpedo attack and pumped :by salvage operations. : :24 April: Near miss close :aboard increased extent of :flooding.	: : : :

Name of Ship	. Date		:No., Weight :Type Bomb	: Time out		: British Notes
YORK		•	•	•	:5 May: Ten near misses.	
(Cont'd.)	•	•	•	•	:	:
(conc a.)	•	•	•	:	:18 May: Direct hit on 'B'	:
•	•	•	:	:	:turret roof by est. 500 Kg.	•
•	•	•	•	:	:bomb wrecked turret and blew	•
	•	•	· •	:	:rear plate into the bridge	:
•	•	:	•	:	:structure. Near miss lifted	:
'	•	:	:	•	:'A' turret off roller path	:
	• •	:	:	:	and split turret sides.	:
	•	:	:	•	:Flooded to W.L. from 14 to	:
	• •	:	:	:	:203 stations.	:
	• •	:	:	•	1	:
	· :	:	:	:	:19 May: Near miss, est.	:
	· •	:	•	:	:500 Kg., increased damage	:
	• •	:	•	:	and flooding.	:
	:	:	•	:	-	:
	•	:	:	:	:20 May: Direct hit on 'Y'	:Vessel abandoned
	:	:	:	:	:turret by est. 500 Kg. bomb	:20 May after all
	•	:	:	:	:wrecked turret.	:secondary armament
	•	:	:	:	:	:removed.
	•	1	:	•	:22 May: Direct hit amid-	:
	•	:	:	:	:ships caused extensive	:
	:	:	:	:	:damage.	:
GLOUCESTER	:Apr. 30.	:Not re-	:D.A. fuses.	:1 day	:Direct hit on upper deck	:Fighting efficiency
	: 1941		:Size not	:(temp.	:passed through 3 decks and	:not impaired except
1936	:	:	:est. l	:repairs)		:for slightly reduced
9400 Tons	:	:	:direct hit,	:	:waterline. Did not explode.	:speed.
12-6" Guns.	:	:	:probably l		:Minor structural damage and	:
	:	:	:near miss.		:slight flooding. Side	:
	:	:	:	:	:plating below waterline had	:
	:	:	:	:	:minor damage from near miss.	:

Name of Ship	: Date	: Attack : by	:No. Weight :Type Bomb	: Time out		: British Notes
1924 6740 Tons Cruiser- Minelayer 4-4.7"Guns.	:May 4, : 1941 :	:Raid on :Liver- :pool :	:Near miss, :no details.		:Superficial splinter damage :while undergoing repairs of :previous damage caused by :mine.	: : : :
COVENIRY 1917 4290 Tons 10-4" AA	:May 17, : 1941 :	:Not re- : ported	:No details : :	: : :	:Minor near miss damage :while being repaired as re- :sult of torpedo attack in :Mediterranean.	:Fighting efficiency :not impaired. :
AJAX 1934 6985 Tons	:May 20, : 1941 :	:Not re- : ported :	:No details : :	: None	:Near miss fractured stem :and bent it below waterline :Minor flooding forward. :Both shafts distorted.	:Speed reduced to 25 .:knots. :
*FIJI 1939 8000 Tons 12-6" Guns.	:May 22, : 1941 :	:Dive :Bombers :	:Several nea :misses Inst :fuse. 2 nea :misses D.A. :fuse. 1 :direct hit :D.A. fuse.	r: :	:During evacuation of Crete, :two D.A. fuse hear misses :caused shock damage to :auxiliaries P-1 gun mount, :electrical power and com- :munication lines, and :caused extensive flooding.	:

Hame of Ship	: Date		:No., Weight :Type Bomb	: Time out of Action		: British Notes
*F]J]		•	•	•	:List to port 25°. Direct	:
(Cont'd.)	•	•		•	:hit caused additional	•
(conc a.)	•	•	•	•	:flooding - and list of 30°.	:
	:	:	•	•	:Ship capsized 1 hr. after	•
	:	•	•	•	:direct hit, due to asymet-	•
		•	•	•	:rical flooding with nega-	•
	•	•	•	:	:tive stability. Compare	*
	•	•	:	•	:with case of U.S.S. RALEIGH	•
	:	:	:	:	:(CL7) damaged Dec. 7, 1941.	
ORION	:May 22	:Not re-	:No details	: None	:In night action during	:
	: 1941	: ported		•	:Crete evacuation; near miss	:
1932	: -,	:	:	•	:caused superficial splinter	
7215 Tons	:	:	:	:	:damage, weakened foremast,	:
8-6" Guns.	:	:	:	:	:damaged aerials.	:
NAIAD	:May 22,	:Not re-	:No details.	:3 weeks	:During Crete evacuation,	:Damage confined to
	: 1941		:Probably	:(temp.	:received excessive splinter	:wholly welded portion
1939	:	:	:both D.A.	repairs)	:damage from stem to 66	:which stood up well
5450 Tons	•	:	and Inst.	:	:station above waterline.	:under shock.
10-5.25"Gun	s:	:	:fuses	:	:Flooded partially forward.	:
	:	:	•	:	:Auxiliary machinery cast-	:
	:	:	•	:	ings fractured.	:
CARLISLE	:May 22.	:Not re-	:Direct hit	:1 month	:During Crete evacuation.	•
	: 1941		:250 Kg.	:	:Direct 250 Kg. hit on left	:
1918	•	:	:Inst. fuse.	:	:gun of No. 2 twin 4" mount-	:
4200 Tons	:	:	:Direct hit	:	ing wrecked guns. Direct 50	
8-4" AA	:	:	:50 Kg .	:	:Kg. hit on after stack des-	
	:	:	:Inst. fuse.	:	:troyed it. Extensive splin-	:
	:	:	:Two near	:	ter damage within 150'	:
	:	:	:misses,	:	:radius. Minor gasoline fire	:
	:	:	:250 Kg.	:	:caused ignition ready use	:
	:	:	:	:	:ammunition. R.D.F. out of	:
	•	•	•	•	action.	:

Name of Ship	: Date	: Attack : by	:No., Weight :Type Bomb	: Time out	: Remarks on Damage	: : British Notes
CLOUCESTER 1936 9400 Tons 12-6" Guns.	:May 22, : 1941 :	:Dive :bombers.	:No details	Sunk	:Attacked by dive bombers :during Crete evacuation; :sunk by direct hit or hits. :	: : : :
AJAX 1934 6985 Tons 8-6" Guns.	:May 28, : 194] :	:Not re- : ported :	:Direct hit- :no details. :	None	:Some damage and a fire; no :details.	:Fighting efficiency :not seriously im- :paired. :
NORFOLK 1928 9925 Tons 8-8" Guns.	:May 28, : 1941 :	:level	:4-100 Kg. :near misses :D.A. fuses.		:Stick of 4 bombs off star- :board bow caused slight :distortion of hull and :leaks in riveted oil tank :connections.	: : :
*ORION 1932 7215 Tons 8-6" Guns.	:May 29, : 1941 : : :	:Not re- : ported	:Two direct :hits, 500 K :D.A. fuses. :Several nea :misses. :	g:(4½ in :U.S.A.)	:During evacuation of Crete. :Near misses caused leaks in :6 oil tanks and flooding of :after 6" magazine. Direct :hit penetrated roof of 'A' :turret, detonating on :roller path and starting a :cordite fire in the turret. :Fires on lower decks. For- :ward magazines flooded as :precautionary measure. :Direct hit on bridge, burst :in lower steering position. :Serious structural damage :over entire width of ship	:steering and telephone :exchange stations :should be separated :more, as a large loss :of key personnel in :these spaces and loss :of communication was :caused by one hit.

Name of Ship	: Date		:No., Weight :Type Bomb	: Time out	: Remarks on Damage	: : British Notes
*ORION	•	•	•	:	:from hold to forecastle	:
(Cont'd.)	•	•	•	:	:deck. Top of 4" magazine	:
(00110 4.)	:	•	•	•	:(80 lb. armor) blown down	•
	•	:	•	•	:6 feet. Fires started in	:
	•	•	•	•	:vicinity of burst. Switch-	:
	•	•		•	:board abandoned; 'A' boiler	•
:	•	•		•	:room evacuated temporarily.	
	•	•		•	:'A' and 'B' turrets out of	•
	•	•	•	•	action. 'X' and 'Y' turrets	•
	•	•	•	•	in local control. Damage	•
,	•	•		•	control position and all	•
	•		•	•	:low power lower control	•
	:	•	•	•	:tower and telemotor leads	•
:	:	•	•	•	:destroyed.	•
*DIDO	:May 29, : 1941	:Dive :bombers	:One 500 Kg. :direct hit, :D.A. fuse.	:5 months :(2½ in :U.S.A.)	:Damaged during Crete evac- :uation. Direct hit on 'B' :turret penetrated roller	:'Q' turret (as well as :'B') would have been out of action if in-
1939 5450 Tons 10-5 1 " Guns	: : : : : : :	:	:Many near :misses.	:	:path and exploded just :above forecastle deck. :Right gun blown overboard. :'Q' turret (just abaft 'B') :had not been installed, but :the foundation was damaged :and roller path distorted. :Fires started from cordite :in 'B' turret. Fumes were :drawn into fwd. boiler room	: : :
5450 Tons	: : : : : : :	: : : : : : : : : : : : : : : : : : : :	:Many near		:path and exploded just :above forecastle deck. :Right gun blown overboard. :'Q' turret (just abaft 'B') :had not been installed, but :the foundation was damaged :and roller path distorted. :Fires started from cordite :in 'B' turret. Fumes were :drawn into fwd. boiler room :and course changed to pre-	:Fires out in an hour.
5450 Tons	: : : : : : : :		:Many near		:path and exploded just :above forecastle deck. :Right gun blown overboard. :'Q' turret (just abaft 'B') :had not been installed, but :the foundation was damaged :and roller path distorted. :Fires started from cordite :in 'B' turret. Fumes were :drawn into fwd. boiler room	:Fires out in an hour. : : : : : : : : : : : : : : : : : : :

Name of Ship	: Date		:No., Weight :Type Bomb			: British Notes
PERTH (H.M.A.S	.):May 30,	:Not re-	:Near misses	:2½ month	s:Damaged during Crete evac-	•
	: 1941	: ported	:no details.	:(est.) i	n:uation. Severe shaking from	:
1934	:	:	:	:Australia	a:near misses caused exten-	:
6980 Tons	:	:	:	:	:sive seepage through rivets	:
8-6" Guns.	:	:	:	:	:in hull. Superficial splin-	:
	:	:	:	:	:ter damage. Oil contamina-	:
	:	:	:	:	:tion. Range keeping instru-	:
	:	:	:	:	ments out of action due to	:
	:	:	:	:	:shock.	:
CALCUTTA	:June 1,	:Not re-	:Direct hit.	: Sunk	:Crete evacuation. No details	3:
	: 1941	: ported	:	:	:available.	:
1918	:	-	:	:	:	:
4200 Tons	:	:	:	:	:	:
8-4" AA	:	:	:	:	:	:



Name of Ship	: : Date	: : Time out : Attack by: of Action		: British Notes
ECLIPSE 1375 Tons 1934	:Nov. 4, : 1940 :	: :One direct:4 months :hit, three: :near miss-: :es - Inst.: :fuses,110; :lb.bombs -: :(est.).	:middle of engine room. Hull dam- :aged down to bilge keel. Engine room	:All DD's to be supplied with 12" manila rope; fitted to shackle on to a cable, with a towing slip, at the other end, to facilitate towing when ship is immoblized.
*KIPLING 1690 Tons 1939	:April 1 : 1940 :	7:Two near :3 months :misses, : :D.A. fuse.: :	:Off Norway - One near miss 30 ft. :abreast boiler room - other 15 ft. :abreast 61 station and burst about :30 ft. under ship. Minor structural :damage. Castings cracked in main :and aux. machinery but ship made :30 kts. for several hours.	:Must have flexible :exhausts from diesel :generators. :Spare lengths of hose :needed to reach from :pumps to any part of :engine room.
*SOMALI 1870 Tons 1938	:May 15, : 1940 : :	:Near miss :14 weeks :by 1000-1b: :bomb, D.A.: :fuse.	:Off Norway. Bomb fell 30 ft. from side, fracturing plating and heavily indenting hull. Structural damage severe forward. Forefoot displaced. Flooded back to Station 30. Aerials blown down. Ship steamed 1000 miles at $11\frac{1}{2}$ knots in calm sea.	:Need more A.A. protection :aft. :
IVANHOE 1370 Tons 1937	:June 1 : 1940 :	, :One direct:7 weeks :hit,2 near: :misses,220: :lb. bombs,: :Inst.fuses:	:Dunkirk. Hit just abaft fwd. funnel causing structural damage to deck and bridge structure. Side damaged by splinters from near misses, both sides. Boiler rooms 1 and 2 flooded slowly, out of action.	: :

Name of Ship	: Date	: Time out : Attack by: of Action		: : British Notes
*BOADICEA		,:Three di- :	:Off France. One bomb passed through	
	: 1940	:rect hits,:	:No. 2 boiler room withdut exploding.	•
1360 Tons	:	:250 lb. :	:One exploded in engine room. Main	•
1931	:	:(two),D.A.:	machinery wrecked and severe	•
	:	:fuses - :	structural damage in vicinity. No.2	
	:	:size of :	:boiler room and engine room flooded	•
	:	:third bomb:	:immediately. Steering gear out of	•
	:	:not est. :	action. Splinter holes below	:
	:	: :	:waterline.	
*BULLDOG	:June 10	,:Three di- :5 weeks	:Off France. One bomb passed through	:
# 3 - 3 11 MAIM 5 2 - 1	: 1940	:rect hits,:	engine room, severed main exhaust	:
1360 Tons	:	:110 lb. :	:pipe and went through side without	:
1931	:	:bombs,D.A.:	exploding. Second bomb came to rest	:
	:	:fuses. :	:inside No. 3 boiler without explod-	:
	:	:	ing. Third bomb pierced funnel,	:
	:	:	entered No.3 boiler and exploded 10	:
	:	:	:minutes later. No.3 boiler room out	:
	:	:	of action and engine room evacuated	:
	:	:	:temporarily. (NB-third bomb must	;
	:	:	:have had low order detonation after	:
	:	:	:being "cooked" in boiler.)	:
FAME	July 6.	:Near miss :3 months	:Off Scotstown. Near miss 5 ft. to	
	: 1940	:200 lbs. :	:port abreast "Y" gun blew hole in	:
1350 Tons	•	:est.,Inst.:	:side and caused severe structural	:
1935	:	:fuse.	damage in vicinity. Serious splinter	•
	:	:	:damage from bridge aft. Cordite	:
	:		:fires started aft but quickly ex-	:
	2	:	:tinguished Telemotor leads and D.G.	:
	:	:	coil cut by splinters. Flooded after	
	•	•	:magazine, shell room and wardroom.	•

Name of Ship	: Date	: : Time out : Attack by: of Action		: : British Notes
MATA MINICOLA	• Tu3 - 1 h	,:Near miss-:4 months	:Off Dover - Near misses at 60, 30,	:
*VANESSA	: 1940	es 250 lbs:	and 20 ft. Minor damage to hull.	:
1090 Tons	• 1940	and 50 lbs:	:Main and aux. machinery seriously	:
1918	•	:mixed.D.A.:	:damaged from cracked castings.	:
1910	•	:fuses.	:Boiler room out of action through	•
	•	•	:leakage of steam. Power lost	:
	•	•	:through damage to dynamos.	•
	•	•	:Secondary lighting all blown down.	:
	•	•	:Flooding forward by oil and water.	:
•	:	:	:Vessel towed to port.	:
			+ Acc Down lat attack several near	*
*BOREAS		,:Near miss-:Not repor	t-:Off Dover. 1st attack: several near :misses, closest 10 ft.abreast after	•
	: 1940	es, un- ed.	engine room. Boiler room fans dis-	•
1360 Tons	:	:known size:	:abled, dynamos damaged, leaks	•
1931	:	:D.A.fuses.:	through cracked circulator inlet	•
	:	:Two direct:	:immobilized only one for 10 min.	•
	:	:hits, 110 :	:2nd attack: two direct hits on	•
	:	:1b.bombs, :		•
	:	:D.A.fuses.:	:bridge. One passed through super-	•
	:	:	structure without exploding. Other	•
	:	:	caused severe structural damage.	•
	:	:	:Near misses caused minor damage	•
	:	:	and flooding. Ship immoblized and	•
	:	: :	:towed to port.	***************************************
*BRILLIANT	•July 2	5,:250 lb. :7 weeks.	:Off Dover. Direct hits each side of	:Necessary to modify
"INTITUTE I	: 1940	and 50 lb.:	:quarter deck. Both passed out	:design of fan engine
1360 Tons	• 1740	:mixed.D.A.:	through side plating without ex-	:platform.
1931	•	:fuses. Two:	:ploding. Tiller flat and after	:
エフノエ	•	:direct	:magazines flooded; minor fire	:
	•	:hits sever-	started. Castings of main and aux.	:
	•	:al near :	:machinery damaged. Ship immobilized	÷
		*	:due to steering gear. "Y" gun'out o	f:
	:	:WIBBGB.	ection Shin towed to vert	:
· .	:	:misses. :	:action. Ship towed to pert.	•

Name of Ship	: : Date	: : Attack by:	Time out of Action		: British Notes
*MONTROSE	:July 27	,:Near miss-:A		:Three attacks. Near misses from	:
	: 1940	:es,500 lb.:n	nonths.	:10 yds. abreast after superstructure	•
15 3 0 Tons	:	:bombs,D.A.:		to 150 yds. abreast after torpedo	•
1918	:	:fuse. :		:tubes. Minor structural damage to	:
	:	: :		:decks and bulkheads, and corrugation	:
	:	: :		of hull below waterline. Cracked	:
	:	: :		castings of turbine feet and aux.	:
	:	: :		:machinery. Stbd. shaft seized.	:
	:	:		:Electric power lost. Radio and	:
	:	: :		steering gear out of action. Engine	:
	:	: :		:room abandoned due escaping steam.	:
WALPOLE	:July 27	.:Near miss-:	7 weeks.	:At Dover. Near misses 30 ft. to	:
111111111111111111111111111111111111111	: 1940	es D.A.	•	:port abreast after steering position	:
1100 Tons	:	:fuses. :		and 30 ft. astern. Cast iron feet of	:
1918	•	: :		:port H.P. and L.P. turbines broke,	
	:			:also damage to various aux.	:
	•	:		:machinery. Temporary loss of elec-	:
	:	: :		:tric power. Speed cut to 10 kts.	:
	•	: :		:Minor buckling of after end up to	:
	:	:		:bulkhead 97.	:
*WINDSOR	:Aug. 11	,:Direct hit:	9 weeks	:Direct hit stbd. side aft. on	:
***************************************	: 1940	:250 lb. :	,	:weather deck, passed through side 3	:
(Escort	::	:bomb, D.A.:		:feet below waterline and exploded.	
Type)	:	:fuse.		:After magazine, shell room and ward-	
-v.E - 1	:	:Several :		:room flooded. Sliding feet of	:
	:	:near miss-:		:turbines broke and castings frac-	:
	:	:eв, 25 lb.:		tured on aux. machinery. Minor	:
	:	:bombs. :		structural damage. One dynamo out of	•
	:	:D.A.fuses.:		action. Ship kept speed of 20 knots.	

Name of Ship	: Date	: Attack by	: Time out		: : British Notes
ACHERON	:Aug. 24	,:One direct	t:13 weeks	:At Portsmouth Dockyard. Direct hit	:
	: 1940	hit, 3	:approx.	on weather deck aft. burst below	:
	:	:near miss-		:deck and wrecked all structure aft.	:
	:	es, D.A.	:	of frame 151. Shafts, propellers	:
	:	:fuses.		and rudder undamaged. After end	:
	:	:	:	:flooded. Steering engine destroyed.	:
	:	:	:	"Y" gun out of action. D.G. cable	:
	:	:	:	:severed.	:
*ATHERSTONE	:Sept.11	,:One direc	t:4 months	:Off Ramsgate. 50 Kg. direct hit on	:
	: 1940	:hit,250 K		:signal deck, passed through fore-	:
904 Tons	:	:Inst.fuse	_	:castle deck, out through side and	•
1940	:	:Two di-	:	exploded in sea. 50 Kg. direct hit	:
•	:	:rect hits	.:	on signal deck penetrated into No. 1	• •
	:	:50 Kg.	:	:boiler room and exploded near hull.	:
	:	:D.A. fuse	.:	:Wrecked boiler room and blew hole	:
	:	:	•	:in side - 250 Kg. direct hit on	•
	:	•	:	:weather deck blew away deck and side	
	:	:	:	:in way of No. 1 boiler room. Severe	•
	:	:	:	splinter damage. Both boiler rooms	:
	:	:	:	:flooded immediately. After guns	:
<u> </u>	:	:	:	could be fired only by local control	L .
DECOY	:Nov. 13	;:Direct hi	t:10 weeks	:At Alexandria. Bomb hit blast screen	n:C.O. recommended in-
	: 1940			of "X" gun and exploded while pass-	stallation of operating
1375 Tons	:	:D.A.fuse.	1	ing through weather deck. Structural	L:rod on sluice valve
1933	:	:	A Section 1	:damage within 12 ft. radius of burst	thetween magazine and
	:	:	•	:Serious splinter damage 142-153	shell room leading to
	;	:	. •	stations. Holes in hull. Fire	:deck over.

Name of Ship	: Date	: : Attack by	: Time out : of Action	_	: British Notes
DECOY (Cont'd.)	:	:	: : :	:started in after magazine and mag- :azine flooded as precautionary :measure. After guns out of action. :Telemotor and steering motor leads	: : :
*CAMERON (ex-U.S.S. Welles) 1190 Tons 1919	:Dec. 5, : 1940 : :	:Near miss, :probably :500 Kg. :Inst. fuse :	:including :conversion	:cut, port side. :In dry dock at Portsmouth. Bombs :struck altar of dock abreast 77 .:station. Side plating blown in for :70-80 ft. Ship lifted bodily and :turned over on port side. Dock :flooded immediately. Oil fire spread :over entire ship. Subsequent flood- :ing by water and oil caused extensitisecondary damage.	:
WITHERINGTON 1120 Tons 1919	:Mar. 11 : 1941 :	;:One direct :hit 50 Kg.:D.A. fuse :One near :miss, 50 :Kg., D.A. :fuse.	:	During air raid on Portsmouth. Direct hit on weather deck want through No. 1 boiler room and burst below the keel. Plating blown up- wards and fractured to 16 ft. above keel. Ship whipped violently, causing severe buckling around the girth at 130-135 stations. Both boiler rooms and some after compart ments flooded at once. Near miss under forward oil tank also fractur ed hull at 32 to 36 stations - Ship towed to mud flats and beached.	: : : : :

Name of Ship	: : Date	: Attack by:	Time out of Action		: British Notes
LEWES (ex-U.S.S. Wickes) 1090 Tons 1918	:Apr. 23, : 1941 : :	:Near miss-: :es. No :details.	7 months	:Damaged during raid on Plymouth. :Minor structural damage. Steam pipes :holed by splinters. Bearing cap and :forward main bearing pedestal of :L.P. turbine fractured. Port after :fuel tanks, ship's side, funnels, :penetrated by splinters.	: : : :
ENCOUNTER 1375 Tons 1934	:Apr. 29 : 1941 :	;:Near miss, :probably :1500 Kg. :bomb, :Inst.fuse. :		:Ship in dock at Malta. Bomb ex- :ploded on dock alter abreast bridge. :Extensive splinter damage over :entire starboard side. Nearly all :light and power lost. Steam pipes, :fire mains and boiler drums pierced :by splinters. Guns severely damaged :by splinters. Fire started in way :of oil tanks which spread to No. 2 :boiler room and down the side to :the dock blocks.	:sea, damage would have :been much reduced. :
ENCOUNTER 1375 Tons 1934	:Apr. 30 : 1941 :	;:Direct hit :50 Kg., :D.A. fuse :	:	:Hit forecastle abaft stbd. hawse- :pipe, went through 3 decks and :exploded in anti-submarine direct- :ing compartment. Port side blown out :over height of 8 ft. above keel, :bulkheads 18 to 28. Lower deck :blown upwards. Minor fire followed.	:
*HURRICANE (Ex- Brazilian) 1340 Tons	:May 8, : 1941 :	:Direct hit :250 Kg., :D.A. fuse.	:	:Damaged during raid on Merseyside. :Bomb went through ship and exploded :beneath. Hole in bottom and plating :dished upwards over area 24x15 ft. :Immediate flooding of after oil	:Vessel would :probably have :foundered if :towed in bad weather. :

BOMB DAMACE CONFIDENTIAL

Name of Ship	: : Date		: Time out : of Action		: British Notes
*HURRICANE (Cont'd.)	: : : : : : : : : : : : : : : : : : : :	:	:	:tanks and engine room; slow flood- ing farther aft. Stern dropped $2\frac{1}{2}$:ft. Serious damage to machinery and :electrical circuits. After gun out :of action due to flooded magazine.	: : : :
VISCOUNT 1120 Tons 1918	:May 8, : 1941	:Near miss. :250 Kg. :Inst.fuse.	including:	:Damaged during raid on Merseyside. :Bomb fell close alongside abreast. :98 bhd. stbd. Side plating blown :in from bilge keel to sheer strake. :Stbd. bearings of L.P. turbine :twisted. No. 3 boiler wrecked. :Serious damage to aux. machinery. :Engine room and after boiler room :flooded. Minor splinter damage.	:Vessel would :probably have :foundered if towed :in bad weather.
FORTUNE 1350 Tons 1935	:May 10, : 1941 :	:Near miss- :es. D.A. :fuse. :	-:6 months, :including :conversion	:In Mediterranean. One burst about :20 ft. under the stern. Hull split :and plating buckled 23 ft. each sid :of split, stbd. side; on port side, :plating buckled from keel to sheer :strake. Severe internal damage. :After magazines and shell room :flooded. Minor flooding in engine :room. Stbd. engine efficiency :reduced by bent shafting and damage :structure.	:Emergency jumping :ladders should be :fixed under escape :hatches. :Portable connection :required between oil

Name of Ship	: : Date	: : Attack by:	Time out of Action		: : British Notes
ENCOUNTER 1375 Tons 1934	:May 16, : 1941 :	:Direct hit: :50 Kg., :D.A. fuse.:		:gun platform penetrated to and :exploded in bilges of No. 2 boiler	:Ship attacked twice :previously at Malta. :Finally repaired :July 7, 1941. : :
HAVOCK 1340 Tons 1937	:May 22, : 1941 :	:Near miss-: :es. Inst. : :fuses. :		:Crete evacuation. Severe splinter :damage to bridge and side. Boiler :room flooded. Cables and steam :pipes severely damaged by splinters. :Ship put out of action.	: : :
KINGSTON 1690 Tons 1939	:May 24, : 1941 : :			:Crete evacuation. 3 fell 20 ft. to stbd. one 50 ft. to port. Minor structural damage. Flooding forward. Cast iron feet of H.P. turbines broke. Severe damage to aux. machinery castings. Stbd. plummer (thrust block fractured.	: .: :
NUBIAN 1870 Tons 1938	:May 26, : 1941 :	:Direct hit :500 Kg., :Inst.fuse.	mate, (at	:Hit weather deck abaft "Y" mounting :blowing away all structure aft above :the waterline - "Y" mounting :destroyed, also steering gear - :Vessel steamed to port at 22 knots.	: :

Name of Ship	: : Date	: : : : : : : : : : : : : : : : : : :	l'ime out of Action		: : British Notes
KELVIN	:May 30,		months.	:In Mediterranean. Near miss 10 f :off stbd. side aft, exploded und	
1690 Tons	:	:eв,250 Kg.,:		:stern. Outer bottom and internal	. :21 knots.
1939	:	:D.A. fuses:		:structure badly buckled from 83	
-,,,	:	: :		:to keel knuckle. After end dropp	
	:	: :		:slightly, disorting port shaft.	Slid-
	:	: :		:ing foot of one H.P. turbine bro	oke.:
	:	: :		:Minor damage forward. After guns	out:
·	:	:		of action due to flooding.	•
NAPIER	:May 31,	:2 near :U	nknown	:250 Kg. near miss at 10 ft; other	ers :Speed cut to 24 knots.
	: 1941	:misses, :		:at unreported distances. Minor	:
1690 Tons	:	:25- Kg. :		:structural damage, but extensive	e :
1939	:	:4 near :		:damage to main and aux. machiner	ry. :
,,,	:	:misses, :		:Fixed and sliding feet of both I	I.P. :
	:	:100 Kg-All:		:turbines fractured. Fuel oil pur	mpa :
	:	:D.A.fuses.:		:fractured, spraying oil over No.	. 2 :
	:	:		:boiler room and putting it tempor	orar-:
	:	: :		:ily out of action.	:
ISIS	:June 15	,:Direct hit:9	months	:Hit in boiler room. Side plating	g :
	: 1941	no details:		:blown inboard(?) and fractured 1	be- :
1370 Tons	:	: :		:tween keel and lower deck, stat:	ions :
1937	:	: :		:40 to 64. Serious damage to decl	ka :
•	:	: :		and bulkheads in this region. M	inor:
	:	:		:damage forward. Deck and side se	everly
	:	: :		:buckled aft, 131 to 138 station	
	:	:		:3 propeller shafts bent and ste	m :
	:	: :		:probably dropped. No. 1 boiler	room:
	:	:		and forward fuel oil tank flood	ed. :
	:	: :		:Ship immobilized and out of act	ion. :

Name of Ship	: Date	: Attack		Time out of Action		Remarks	: : British Notes
ILEX		:No detai			•	French aircraft. No	•
	: 1941	•	-	_		structural damage avail-	:
1370 Tons	:	:	:ប.	.s.A.)		us flooding amidships,	:
1937	:	:	:			oiler rooms. Out of	:
	:	•	:		:action and	taken in tow.	:
*VANESSA	:June 19	.:Direct h	it : 8	months.	:Penetrated	sheer strake and burst in	n:
	: 1941	:100 Kg.,	. :		:No. 1 boile	r room close to ship's	:
1090 Tons	:	:D.A. fus	e.:		:bottom. Hol	e in shell 6x9 ft. Outer	:
1918	:	:	:		:bottom plat	ing blown upwards.	:
	:	:	:		:Weather dec	k split along centerline	•
•	:	:	:		:over machin	ery spaces and blown up-	:
	:	:	:		:wards. Two	boiler rooms flooded.	:
	:	:	:		:Main engine	s out of action by loss	:
	:	:	:		of steam. N	o. 1 boiler exploded.	:
	:	:	:		:No. 2 boile	r severely damaged. For-	:
	:	:	:		:ward funnel	blown overboard. Radio	:
· · · · · · · · · · · · · · · · · · ·	:	:	:		:destroyed a	nd D.G. out of action.	:
WATERHEN	:June 29	.Near mis	:s- :Si	unk next	Off Tobruk.	Bombs fell close along-	•
	: 1941	:es. No		ay.		jammed, ship listed,	:
(H.M.A.S.)	:	:details.				s blown out. Hole 8 ft.	<u>:</u>
1100 Tons	:	:	:			waterline in way of	:
1918	:	:	:		• ,	and oil tank, which	:
•	•	:	:		_	once. Severe structural	:
	:	:	:			ed flooding aft. Ship	:
	:	:	:			ith heavy list to stbd.;	<u>:</u>
	:	:	:			ed and taken in tow.	:

Name of Ship	: Date	: : Attack by	: Time out : of Action	•	Remarks	: : British Notes
*FIREDRAKE	:July 23,	,:One near	:6 months.	:Miss close	alongside No. 1 boile	er :
	: 1941	:miss, 100	:	:room, tore	side and blew it inwa	ards :
1350 Tons	:	:Kg., Inst.	:	:from deck t	to bilge keel, 67 to 8	30 :
1935	:	:fuse.	:	:stations. M	finor splinter damage.	. :
	:	:	:	:Boiler room	s 1 and 2 flooded. No	o. 1 :
	:	;	:	:boiler lift	ed 19 inches on one	side.:
	:	:	:	:Ship immobi	lized temporarily by	loss:
	:	:	:	_	No. 3 boiler. Ring me	
	:	:	:		.) fractured, stbd. G	
	:	:	:		on. Raised steam and	
	:	:	:	:made 9 knot	1	:


Destroyers		: Date	: Attack by	: Remarks
MOHAWK 1870 Tons	1939	:16 Oct. 1939 : : :	:2 near misses, inst. :fuse. :	:Both bombs 45° to stbd. Damage mainly :by splinters. All control and gun :circuits out of action. Many :casualties stress need of splinter :protection.
KIMBERLEY 1690 Tons	1939	:April 14, 1940	:Not reported.	:Minor damage from splinters. :Fighting efficiency unimpaired.
GREYHOUND 1335 Tons	1936	:April 18, 1940 : :	:Not reported. :	:Minor damage to forecastle and :mess deck. Shield and supports :for 'A' gun slightly buckled. :One month to repair.
ASHANTI 1870 Tons	1938	:Apr11 28, 1940 : : :	:Near misses, both :inst. and D.A. fuses :	:Off Norway. Castings cracked one .:dynamo. Splinter damage. Leaks :in oil fuel tanks (one bomb :abreast tank) 3 weeks out of :action.
WITHERINGTON 1120 Tons	1919	:April 29, 1940	:One near miss, inst.	:Minor splinter damage. 3 days :out of action
WREN 1120 Tons	1919	:April 31 to :May 16, 1940.	:Not reported.	:Off Norway. Minor damage. No time :out of action.

Destroyers		: Date	: Attack by	: Remarks
MAORI 1870 Tons	1939	:May 2, 19	:bombs, all near	· · · · · · · · · · · · · · · · · · ·
WHITSHED 1120 Tons	1 919	:May 10, 1	940 :Not reported.	:Director and steering gear damaged.
HESPERUS		:May 12, 1		os- :Off Norway. Minor damage aft; side off :plating and bulkheads buckled. :Four weeks out of action.
VERSATILE 1090 Tons	1918	:May 13, 19 : : : :	940 :One direct hit, :several near misse :50 lb. bombs, inst :fuses. Machine gun :attack.	. : after auxiliaries burst. Ship immobilized.
WIVERN 1120 Tons	1919	:May 14, 19	940 :Near miss, 500 lb. :bomb, inst. fuse. :	:Off Holland. Splinter holes through side! Serious cordite fire at "X" and "Y" guns and in after magazine. Steel helmets for all. Anti-flash clothing needed for gun crews and supply parties. 4 weeks out of action.

Destroyers		:	Date	: Attack by	: Remarks
WINCHESTER (escon	rt type) 1918	:May :	15, 1940	:Six near misses :lb. bombs, both :and D.A. fuses.	, 500 :Dropped 50 to 100 yds. from ship. Minor inst.:structural damage. Severe machinery :damage by failure of cast iron. Ship :immobilized. Four weeks out of action.
WIVERN 1120 Tons	1919	:May	15, 1940	:Near miss, Inst :fuse.	. :Splinter damage. Wardroom wrecked. :Ship seaworthy. Out of action 5 weeks.
MALCOLM 1530 Tons	1918	:May : :	20, 1940	:Ten near misses: :Inst. fuses. :	, :4 abreast bridge, nearest 20 yds; :6 aft, nearest 5 yds. Splinter :damage. Minor fires. Radio aerials :and degaussing cable cut by splinters. :4 days out of action.
VANSITTART 1120 Tons	1919	:May :	21, 1940	:Not reported.	:Structural damage aft. All instruments and circuits to after guns burnt. One :month out of action.
KEITH 1400 Tons	1930	:May :	21, 1940	:Several near mi :500 lbs. inst. :Machine gun at	sses, :At Dunkirk. Average near miss, 20 yards. fuses :Minor damage from splinters and tack. :machine gun bullets.
WILD SWAN 1120 Tons	1919	:May	22, 1940	:Near miss, ins	t. fuse::Off Boulogne. Minor damage by :splinters. One week out of action.

Destroyers		: Date	: Attack by	: Remarks
KEITH 1400 Tons	1930	:May 23, 1940 : :	:Near miss, 50 lb. :bomb, inst. fuse. :Machine gun attack.	:At Boulogne. Minor structural damage to forecastle deck. Upper works generally riddled with bullets and splinters. Six days out of action.
VENEMOUS 1120 Tons	1919	:May 23, 1940 :	:Near miss, D.A. fus : :	e.:Off Boulogne. Bomb 20 ft. off stbd. :quarter. Slight damage to shaft. :Minor structural and splinter damage.
FAME 1350 Tons	1935	:May 23, 1940 : :	:One near miss, D.A. :fuse. :	:Bomb 10-20 yds. off port quarter, :lifted stern. Steering motors siezed :up. Need for even and firm tightening :of holding down bolts to aux. machinery. :No repair period.
FIREDRAKE 1350 Tons	1935	:May 23, 1940 :	:Near miss. :	:At Narvik. Bomb 20 ft. from ship. :Splinter holes above and below :waterline. No repair period.
VIMIERA (escort 900 Tons	type) 1917	:May 24, 1940 : :	:Near misses, 110 lb :D.A. fuses. :	es,:Explosions beneath ship. Minor :straining of structure. Roller paths :of after guns distorted slightly. :Governor valve gear box on generators :cracked and all power failed. 10 days :out of action.

Destroyers		: Date	: Attack by	: Remarks
WOLFHOUND 1100 Tons	1918	May 27, 1940	:Four near misses, :250 lbs., D.A. fuse:	:Off Belgium. Nearest miss 20 ft. s.:No structural damage. Dynamo feet, :cast iron, cracked. 10 days out of :action.
WHIRLWIND 1100 Tons	1917	:May 27, 1940	:Not reported.	:Minor damage reduced speed temporarily. :No repair period.
WALKER 1100 Tons	1918	:May 27, 1940 :	:Not reported.	:Minor structural damage. Cast iron :feet of dynamo fractured. 10 days :out of action.
WINDSOR (escort 900 Tons	type) 1918	:May 28, 1940	:Not reported.	:Minor damage to hull and aerials. :No repair period.
CREYHOUND 1335 Tons	1936	:May 29, 1940 : :	:Two near misses, :Inst. fuses. :	:At Dunkirk. Both bombs 6 ft. from side. Much fragment damage. Ship immobilized by loss and contamination of feed water. 3 weeks out of action.
JAGUAR 1690 Tons	1939	:May 29, 1940 : :		:At Dunkirk. Bombs about 10 yds. off s.:port beam. Much splinter and bullet de:damage. Engine room and steering gear out of action due to damaged steam pipes. 16 days out of action.

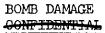

Destroyers		: Date	: Attack by	: Remarks
GALLANT				
1335 Tons	1936	:May 29, 1940	:Near miss, Inst.	:At Dunkirk. Miss 100 yds. off stern.
		:	:fuse.	:Splinter damage and flooding aft.
		:	: ,	:Primary steering inoperative. One
	· · · · · · · · · · · · · · · · · · ·	•	•	:week out of action.
INTREPID				
1370 Tons	1937	:May 29, 1940	:Near miss, Inst. fu	use.:Dunkirk. Hit abreast 'B' gun
1		:	:	:pierced main steam line in boiler
		:	:	:room. All five control circuits
		:	:	out of action. Fires started and
		:	:	:magazines fwd. flooded. Aux.
		:	:	:machinery damaged by splinters. 2
•		:	•	:weeks out of action.
SALADIN				
905 Tons	1919	:May 29, 1940	:Not reported.	:Dunkirk. Minor structural damage
		:	:	:by splinters. Ready-use cordite
		:	•	:caught fire. 11 days out of action.
ANTHONY	······································			
1350 Tons	1930	:May 30, 1940	:Not reported.	:Dunkirk, Turbine feet cracked.
>>	- >>	:	:	:Ship towed to port. 2 weeks out of
		:	•	action.
DEAGER				
BEAGLE 1360 Tons	1021	•Morr 70 1010	.W wis- 050 11	Desired Desire
TOO TONS	1931	:May 30, 1940	:Near miss, 250 lb. :bomb.	
		•	· DOMD ·	:'A' gun. Balance weight on gun :sheared off.
		•	*	· SHOCK CK OII.
SABRE				
905 Tons	1919	:May 30, 1940	:Not reported	:Dunkirk. Minor fire damage followed
		:	:	:bombing. No repairs.

Destroyers		: Date	: Attack by	: Remarks
EXPRESS 1375 Tons	1934	:May 31, 1940	:Not reported.	:Dunkirk. Superficial splinter :damage. One week out of action.
WORCESTER 1120 Tons	1922	:June 1, 1940 :	:Not reported.	:Dunkirk. Minor splinter damage :followed by collision. 6 weeks :out of action.
VIVACIOUS 1090 Tons	1917	:June 1, 1940	:Not reported.	:Dunkirk, Minor damage. One week :out of action.
SABRE 905 Tons	1919	:June 2, 1940	:Not reported.	:Dunkirk, Minor damage. One week :out of action.
ESK 1375 Tons	1934	:June 3, 1940	:Not reported.	:Dunkirk. Splinter damage in way :of oil tanks. 8 days out of action.
FIREDRAKE 1350 Tons	1935	:June 12, 1940 : :	:Near miss. :	:Hit 20 ft. from side; splinter :damage above and below waterline. :Port steering motor damaged. One :week out of action.
FAME 1350 Tons	1935	:June 12, 1940	:Near miss.	:Minor splinter damage. 'A' gun :out of action. One week to repair.

Destroyers		: Date	: Attack by	: Remarks
BEAGLE 1360 Tons	1931	:June 12, 1940	:Near miss.	:Minor structural damage. 'A' gun :out of action. 4 days to repair.
WALKER 1100 Tons	1918	:June 12, 1940 :	:Near misses. :	: Hinor damage to aux. machinery. :Oil tank leak and shaft vibration. :12 lays out of action.
DIAMOND 1375 Tons	1932	:June 17, 1940	:Near miss. :	:Minor splinter damage. No repair :period.
JERVIS 1690 Tons	1939	:July 3, 1940 :	:Not reported.	:Off Malta. No details. No time out of action.
HAVOCK 1340 Tons	1937	:July 19, 1940 : : :	:Not reported. :	:In Mediterranean. Hull damaged abreast :No. 2 boiler room. Minor damage to :boiler feet and aux. machinery; minor :flooding from strained rivets. :8 weeks out of action.
GRIFFIN 1335 Tons	1936	:July 19, 1940 : :	:Near miss. 250 lb. :bomb, D.A. fuse. :	:Structural damage to hull from stem :to 33 station, both sides. Slow :flooding forward. Speed cut to 20 :knots. 2 weeks out of action.

Destroyers	_	: Date	: Attack by	Remarks
BEAGLE 1360 Tons	1931	:July 19, 1940	:Near misses 250 lb. :and 50 lb. mixed. :D.A. fuses. :	:Off Dover. Near misses. 10-200 :yds. Minor structural damage :near bridge. Cast iron fittings :on 3 boiler room fans put boiler :room out of action.
BEAGLE 1360 Tons	1931	:July 20, 1940 : :	:Same as on July 19t	h.:Off Dover. Near misses 10-20 yds. :Strained at frame 61 and leaks in No. 1 :boiler room. Port steering unit :damaged. 3 weeks out of action from :attacks on 19 and 20th.
SCIMITAR 905 Tons	1919	:Aug. 11, 1940 : :	:10-15 near misses, :inst. fuses. :	:Portland Harbor. Nearest miss was :20 yds. Minor fires and splinter :holes in hull. D.G. cable cut. 4 :days out of action.
SKATE 900 Tons	1918	:Aug. 11, 1940 :	:Not reported.	:Minor damage to bridge structure :during air raid on Portland.
ESK 1375 Tons	1934	:Aug. 11, 1940 :	:Not reported. :	:4 near misses damaged rudder. :One week out of action, inc. :other work.
WATCHMAN 1100 Tons	1918	:Aug. 12, 1940	:Not reported.	:Minor damage from near misses :loosened strut arms.

Destroyers		:	Date	: Attack by	: Remarks
BUILDOG 1360 Tons	1931	:Aug.	24, 1940	:Not reported.	:Splinter damage during air raid :on Portsmouth. 9 days out of action.
BEAGLE 1360 Tons	1931	:Aug.	, 1940	:Not reported.	:Minor damage off Portland Bill. :6 days out of action.
CATTISTOCK 904 Tons	1940	:Nov.	10, 1940	:Near miss. :	:Superficial splinter damage. One :day out of action.
FORESIGHT 1350 Tons	1935	:Dec.	22, 1940	:Near miss. :	:During air raid on Liverpool. :Minor damage to hull and :superstructure forward.
CASTLETON (ex-U.S	S.S. Aaron				
J090 Tons	1919	:Jan. :	18, 1941	:Near miss.	:In drydock at Portsmouth. :Superficial splinter damage.
BOREAS 1360 Tons	1931	:Jan. :	19, 1941	:Near miss. :	:Superficial splinter damage while at Millwall Docks, London, undergoing repair of damage of July 25, 1940.
DECOY 1375 Tons	1.933	:Jan. :	19, 1941	:One direct hit, est. :500 Kg., D.A. fuse.	:At Malta under repair. Bomb passed :through deck and out side above

Destroyers		: Date	: Attack by	: Remarks
DECOY (Cont'd.)		:	: : :	:waterline, and exploded in water. Fore :end severely shaken. Minor structural :damage. 'A' gun support buckled and :loading arm fractured. Asdic out of :action.
ST. LAURENT (R.C.N 1390 Tons	1931	:Feb. 14, 1941	:Near miss.	:Minor structural damage and slight :leakage. No repair period.
STUART (H.M.A.S.) 1530 Tons	1918	:Feb. 19, 1941	:Four near misses, :D.A. fuses.	:Off Benghazi. Stern whipped, one :dynamo tripped. No repair period.
*SHERWOOD (ex-U.S. "Belmont") 1190 Tons	.s. 1919	:March 10, 1941 :	:Two near misses, :inst. fuses.	:During air raid on Portsmouth. :Misses 20 to 30 ft. away. Minor :splinter damage and slight flooding.
TYNEDALE 904 Tons	1940	:Merch 11, 1941	:Three near misses, :D.A. fuse. :	:During air raid on Fortsmouth. :Minor splinter damage. Cast iron feet :of one turbine broken, and minor :damage to aux. machinery. 9 days out :of action.
CATTISTOCK 904 Tons	1940	:March 3, 1941	:Near miss. No de- :tails.	:Minor defects. 5 days out of action.

Destroyers		: Date	:	Attack by	: Remarks
ANTHONY 1350 Tons	1930	:March 16, :	1941 :Nea :tai :	r miss. No de- ls.	:Demaged while under repair at :Clyde Bank. Superficial splinter :damage only.
LEWES (ex-U.S.S. W	lickes) 1918	:March 23, : :	1941 :Nea : :	r misses.	:Damaged while under repair. One near :miss close to stern and several others :around ship caused splinter damage to :structure and to machinery.
GRIFFIN 1335 Tons	1936	:March 23,	1941 :One :fus	near miss. Inst. e.	:Superficial splinter damage penetrated :oil tanks above the waterline.
FORESTER 1350 Tons	1935	:March 30,	1941 :0ne :	near miss.	:Minor damage and fuel tank leakage. :One month out of action.
QUORN 904 Tons	1940	:April 1, 1; : :		near misses. . fuses.	:Both bombs exploded underwater :about 20 yds. off the port quarter. :Four keeps to turbine feet broke. :No repair period.
WIID SWAN 1120 Tons	1919	:April 20, :	1941 :Near :	r miss.	:During raid on London. Minor blast :damage. Oil tanks leaking.
GREYHOUND 1335 Tons	1936	:April 23, 3	1941 :Near	r misses.	:Damaged slightly at Mersa-Matruh. No :repair period.

Destroyers			Date	:	Attack by	: Remarks
NUBIAN 1870 Tons	1939	:April	29, 1941	:Two	near misses.	:Distances 10 and 20 ft. off bow. :Minor structural damage. Hull :buckled and distorted forward of 36 :station. No repair period.
SOUTHDOWN 904 Tons	1940	:April : :	5, 1941		near misses, Kg., D.A. fuses.	:Misses 10 to 30 yds. astern. One steering :motor badly damaged. Turbine holding- :down bolts bent. Slight leakage to :magazines. No repair period.
VOLUNTEER 1120 Tons	1919	:May 5	, 1941	:Near	r misses.	:At Belfast. Extensive but not serious :splinter damage above waterline.
WHADDON 904 Tons	1940	:May 8	, 1941	:Near	r misses.	:Under repair in Tyne. Splinter damage.
VIVACIOUS 1090 Tons	1917	:May 8	, 1941	:Near	r misses.	:Under repair in Tyne. Splinter damage.
RIPLEY (Ex U.S.S. 1090 Tons	Tillman) 1919	:May 1	2, 1941	:Near	misses.	:Splinter damage caused cordite fire :on weather deck.
ANTHONY 1350 Tons	1930	:May 1	3, 1941	:Near	misses.	:Air raid on Glasgow district. Super- :ficial splinter damages.

Destroyers		: Date	: Attack by	: Remarks
ILEX 1370 Tons	1937	:May 24, 1941 :	:Near miss, D.A. fuse:	.:Crete evacuation. Near miss under :stern damaged propellers and rudder. :Hit again June 15th.
IMPERIAL 1370 Tons	1937	:May 21, 1941 :	:5 near misses. Type :not known.	:Superficial splinter damage aft. :No repair period.
NIZAM 1690 Tons	1939	:May 29, 1941 :	:One near miss, 250 :Kg., D.A. fuse.	:15 ft. off port quarter. Minor :structural damage and leaks. Port :plummer (thrust) block out of alignment.
DECOY 1375 Tons	1932	:May 29, 1941 : :	:5 near misses, D.A. :fuses. :	Engine room bulkheads slightly buckled. Cast iron feet of L.P. turbines broke. Minor damage to aux. machinery. Speed reduced to 26 knots.
JACKAL 1690 Tons	1939	:June 15, 1941 :	:Direct hit, 500 Kg., :D.A. fuse.	:Off Syria. Bomb hit edge of deck, deflected into sea. Explosion caused minor damage to hull.
DECOY 1375 Tons	1935	:July 9, 1941 :	:One near miss. No :details.	:Minor damage to side. Leaks into oil :tanks and to boiler room. Minor :damage to aux. machinery.
GARTH 904 Tons	1940	:July 23, 1941	:Near miss, D.A. fuse	.: Keeps to 4 turbine feet fractured.



Destroyers		: Date	: Attack by	•	Remarks
GHURKA					
1870 Tons	1937	:April 9, 1940			orway. Flooded engine room and
		:	:150 yds to alongsid		comp'ts. aft. Fuel oil fire under
•		:	:		superstructure; ship listed. When
		:	:		was pumped overboard, ship sank.
		:	:		Stability was lost when oil pumped
		•	•		rrect list a dangerous practice
			•	•111 des	scroyers.
AFRIDI					
1870 Tons	1937	:May 3, 1940	:2 direct hits, D.A.	:Off No	orway. 1st bomb exploded in boiler
		:	:fuses.		plowing hole in hull. Fire in radio
		:	:		2nd bomb blew in hull forward
		•	:		ire started in mess decks. Ship
		:	:		zed and sank bow first 46 minutes
		:	. .	:after	1st hit.
VALENTINE					-
900 Tons	1917	:May 15, 1940	:One direct hit and	:Direct	t hit down funnel, wrecked No. 2
	•	:	:one near miss, 250		room, flooded engine and No. 1
		:			rooms. Near miss blew hole 20 ft.
•		:	*		meter in side forward. Magazine
		:	:		ot explode but cordite fire started
	·	:		:Ship b	peached off Holland and abandoned.
WHITLEY			-		
900 Tons	1918	:May 19, 1940	:Not reported.	:Beache	h.
		17, 17 1 0	1100 TOPOT 000.	.Doaone	7U. 6
WESSEX	_				
1100 Tons	1918	:May 24, 1940	:Not reported.	:Sunk.	No details available.

Destroyers		: Date	: Attack by	: Remarks
GRENADE 1355 Tons	1935	:May 29, 1940	:Not reported.	:Sunk. Attacked at Dunkirk, set afire, :later sank.
BASILISK 1360 Tons	1930	:June 1, 1940 :	:Direct hits and :several near misses.	:Off La Panne. Direct hit aft put No. 3 :boiler room out of action. Further :hits and near misses sank ship.
HAVANT 1340 Tons	1939	:June 1, 1940	:Several direct hits.	:Dunkirk. No details.
KEITH 1400 Tons	1930	:June 1, 1940 :	:Several direct hits and near misses.	:Off Bray. 2 hits in machinery spaces :immobilized ship. Listed to port. :Second attack lifted stern and ship :capsized.
KHARTOUM 1690 Tons	1939	:June 26, 1940 : :	:Suspected air attack : :	::In Red Sea. Internal explosion burst :torpedo air flask, warhead discharged :aft as a projectile. After magazine :and 4 warheads exploded. Fire started aft.
BRAZEN 1360 Tons	1930	:July 20, 1940 : : :	:Near misses, mixed :sizes. D.A. and Inst :fuses. :	:Off Dover. One burst close to port beam .:under keel, another close alongside on :the surface, others at unknown positions. :Severe hull damage amidships, keel :split. Major splinter damage amidships.

Destroyers		: Date	: Attack by	: Remarks
BRAZEN				
(Cont'd.)		•	•	:Boiler and machinery spaces flooded
(•	•	rapidly. Broke in two while being
		:	:	towed and after end sank. Fore end
		:	:	:destroyed by gunfire.
WREN				
1120 Tons	1919	:July 27, 19	40 :Two direct hits or	:Hits starboard side abreast wardroom
		:	:very near misses.	severely damaged all structure abaft
		;	:D.A. fuses. Many	the engine room. Ship broke in two
		:	other near misses.	and both halves sank.
		:	:Probably 500 lbs.	:
*CODRINGTON				
1530 Tons	1930	:July 27, 19	40 :Not reported.	:In Dover Harbor. Hit at after end
		•	:	:broke the ship's back and grounded
		:	:	from No. 3 gun to the stern. No
		:	:	:further details.
DELIGHT				
1375 Tons	1932	:July 29, 19	40 :Direct hit and near	:Off Portland Bill. One bomb struck
		:	:misses.	:forecastle glancing blow, causing
		:	:	serious splinter damage to ship's side.
		:	:	:Serious fire started, fed by oil from
		:	:	:damaged tanks. Lights failed and main
		•	*	steam line broke. Forward magazines
		:	•	:believed flooded, but ship sank following
		:	•	:big explosion forward.

BOMB DAMAGE CONFIDENTIAL

Destroyers		: Date	: Attack by	: Remarks
DAINTY				
1375 Tons	1933	:Feb. 24, 1942	:500 Kg., very short delay, possibly	:Severe structural damage. ed:Port side opened up and weather deck :blown off. Serious oil fire aft, :eventually under control. Air flasks :of torpedoes appear to have burst;
·		: : :	: : :	:warheads and depth charges burst open and burned. Main engines O.K. Violent explosion aft broke ship in two (probably warhead magazine).
DIAMOND 1375 Tons	1932	:April 27, 1941	:Direct hits, from s	ix:Evacuation of Greece. Ship sank :impediately.
WRYNECK (escort t 900 Tons	ype) 1918	:April 27, 1941	l:Direct hits, from :six Junkers 88's.	:Evacuation of Greece. Ship sank in :4 minutes.
<u>ЛЛЮ</u> 1690 Tons	1 939	:May 21, 1941 :	:Direct hit(s) by ` :dive bomber(s).	:Crete evacuation. No details available
GREYHOUND 1335 Tons	1956	:May 22, 1941 :	:Direct hit(s) by :dive bomber(s).	:Crete evacuation. No details available
KELLY 1690 Tons	1.939	:May 23, 1941	:Direct hit(s) by :divo bomber(s).	:Crete evacuation. No details available

Destroyers	: Date	: Attack by	: Remarks
KASHMIR 1690 Tons 193	9 :May 23, 1941 :	:Direct hit(s) by :dive bomber(s).	:Crete evacuation. No details available.
*MASHONA			
	:May 28, 1941 : : : : : : : : : : : : : :	:100 Kg., Inst. fuse :many other near mis	:Hole 14x5 ft. blown in side in way of -:No. 1 boiler room. Extensive splinter s-:damage to steam and feed lines. by:3 boiler rooms eventually flooded. :Minor fire in 'B' magazine. All lighting :lost. Steering disabled. Power failed :as boiler room flooded slowly. Ship :capsized and floated bottom up, :flooded from bulkheads 30 to 98. This :case emphasized disadvantage of lining :ship's side in vicinity of the water- :line (which makes it difficult to plug :splinter holes). Linings were removed :in H.M. Navy but later ordered replaced.
HEREWARD 1340 Tons 193	6 :May 29, 1941	:Direct hit(s).	:Crete evacuation. No details available.
WATERHEN (H.M.A.S.)			
1100 Tons 191	8 :June 30, 1941	? :	:See May 29th under "Major damage." :List increased and ship capsized :and sank while being towed.
DEFENDER 1375 Tons 193	2 :July 11, 1941 : :	:Direct hit - no :details.	:Off Tobruk. Hit in machinery spaces :flooded engine and after boiler rooms. :Back probably broken; listed heavily :and sank while being towed.

Monitors		: Date	: Attack by	: Remarks
TERROR 7200 Tons	1916	:Feb. 22, 1941 :		:Severe internal damage and :flooding.
TERROR 7200 Tons	1916	:Feb. 23, 1941 :		:Severe. Ship abandoned. :Sunk by British.
* MARSHAL SOULT 6400 Tons	1915	:March 10, 194] :	:Portsmouth. Direct :hit, 50 Kg., Inst. :fuse.	:Moderate damage.

Sloops, Corvettes, Minesweepers.	: Date	: Attack	: Remarks
*PELICAN Escort Type Sloop 1938	:April 22, 1940 : :	:Norway. One direct :hit, D.A. fuse; 2 :near misses, Inst. :fuses. All est. :250 lb.	:Severe damage 7 months. :
AUKLAND Escort Type Sloop 1938	:April 24, 1940	:Near miss; Inst. :fuse.	:Splinter damage.
BLACK SWAN Escort Type Sloop 1939	:April 28, 1940	:Norway. Direct hit :D.A. fuse.	:Passed through ship, :exploded underneath. 5 weeks.
BITTERN Escort Type Sloop 1937	:April 30, 1940	:Namsos. Direct hit, :500 lb. Inst. fuse.	
*HUSSAR Minesweeper 1934	:May 15, 1940	:North Sea. Direct :hit, Inst. fuse.	:Moderate damage 6 weeks.
*HARRIER Minesweeper 1934	:May 25, 1940 :	:Zeebrugge. Direct :hit, 250 Kg., D.A. :fuse; 2 near misses	:Direct hit passed through
*BIDEFORD Escort Type Sloop 1931	:May 29, 1940 :	:Dunkirk. Two direct :hits, D.A. fuses, :250 lb. bombs.	:Serious damage.

Sloops, Corvettes, Minesweepers. (Cont'd.)	: · Date	: Attack	: Rema	rks
PANGBOURNE Minesweeper 1917-19	:May 29, 1940	:Dunkirk. Near miss- :es. D.A. fuses.	:Slight. 3 week	8.
KELLETT Minesweeper 1917-19	:May 30, 1940	:Dunkirk. Near miss- :es, Inst. fuses.	:Slight. 2 week	8.
HERE	:May 31, 1940	:Dunkirk. Probably :near misses.	:Slight. 5 days	•
MOSQUITO Gunboat 1940	:June 1, 1940	:Dunkirk. No details	:Sunk.	
SALAMANDER Minesweeper 1936	:June 1, 1940	:Dunkirk. No details	:Serious. 6 wee	ks.
SKIPJACK Minesweeper 1934	:June 1, 1940	:Dunkirk - direct :hits.	:Sunk.	
*FOXGLOVE Escort Type Sloop 1915	:July 9, 1940 : :	:Portsmouth. 3 :direct hits; 110-1b :Inst. 500 lb. Inst. :110 lb. D.A. fuses. :Also 2 near misses.	: :	tensive.
CUILLEMOT Patrol Type Sloop 1939	:July 30, 1940	:250 lb. near miss. :D.A. fuse.	:Slight.	

MISCELLANEOUS CRAFT

Sloops, Corvettes, Minesweepers. (Cont'd.)	. :	bete 	:	Attack	:	Remarks
TELWORTH Mineaveeper 1917-19	:July	30, 1940	:Dover.	Near misses, fuses.	:Moderate.	11 weeks.
KINGFISHER Patrol Type Sloop	:Aug.	14, 1940	:Near m	usses, Inst.	:	
*MALLARD Patrol Type Sloop 1936	:Sept :	. 30, 1940	:hit. 5	O Kg.; 2 near; all D.A.	:ship, expl	t passed through loded beneath. mage. 9 months.
ANEMONE	:Oct.	28, 1940	:Liverp	ool. Near	:Slight.	
*PINTAIL Patrol Type Sloop 1939	:Nov.	1, 1940	:hits,	Sea. 2 direct one Inst. and A. fuse.		∤½ months.
EGRET Escort Type Sloop 1200 Tons 1938	:Nov.	7, 1940	:Thames	. Near miss,	:Slight. 1	week,
SALTBURN Minesweeper 1917-19	:Jan.	9, 1941		outh dockyard. iss. Type	:Nil	

Sloops, Corvettes, Minesweeper (Cont'd.)	s.: Date	: Attack	: Remarks
HUNTLY Minesweeper 1917-19	:Jan.31, 1941 :	:Tobruk. Direct hits, :D.A. fuses.	:Sunk.
BRAMBLE Patrol Type Sloop 1938	:Feb. 20, 1941	:Harwich, Direct hit.	:Slight. 4 days.
BRITOMART Patrol Type Sloop 1938	:Mar. 15, 1941 :	:Rye Harbour. Direct :hit, 100 Kg. D.A. :fuse.	:Moderate. $2\frac{1}{2}$ months.
STOKE Minesweeper 1917-19	:Apr. 30, 1941	:Near miss. Size and :type unknown.	:Slight. 2 weeks.
ERNE Escort Type Sloop 1940	:Apr. 30, 1941 :	:North Sea. Direct :hit, 100 Kg. D.A. :fuse. 2 near misses. :D.A. fuses.	:Moderate. :
FERMOY Minesweeper 1917-19	:Apr. 30, 1941 :	:Malta. Direct hit. :Size and type un- :known.	: :
	: :May 1, 1941 :	:Malta. Direct hit. :Size and type un- :known.	: Wrecked beyond repair. :

MISCELLANEOUS CRAFT

Sloops, Corvettes, Minesweep	ers.: Date	: Attack	:	Remarks		
*SELKIRK Minesweeper 1917-19	:May 4, 1941 :	:Rough Buoy. Near :miss, 500 Kg. D.A. :fuse.	:Moderate.	3 months.	· ·	
LA MALOUINE	:May 5, 1941 :	:Belfast. Near miss. :Size and type un- :known.	: Moderate. ;	3 months.		
STOKE Minesweeper 1917-19	:May 7, 1941 :	:Direct hit. Size :and type unknown.	:Sunk.			
SALVIA	:May 18, 1941 :	:Suda Bay. No other :data given.	:			
WIDNES Minesweeper 1917-19	:May 18, 1941	:Near miss. Size :and type unknown.	:Nil.			
WIDNES Minesweeper 1917-19	:May 20, 1941 :	:Cape Drepano. 3 :near misses. D.A. :fuses.	:Beached.			
GRIMSBY Escort Type Sloop 1933	:May 25, 1941 : :	:Mediterranean. 2 :direct hits. D.A. :fuse. Near miss. :100 Kg. D.A. fuse.	:Sunk.			

Sloops, Corvettes, Minesweeper (Cont'd.)	rs.; Date	: Attack	: Rema	rks
AUKLAND Escort Type Sloop 1938	:June 24, 1941	:Size and type not :known.	:Sunk.	
FLAMINGO Escort Type Sloop 1939	:June 30, 1941	:Libyan Coast. 2 :near misses. 500 K :D.A. fuse. 6 near :misses. 250 Kg. :Inst. fuse. Other :near misses, 50 Kg :Inst. fuses.		
HYACINTH	:July 5, 1941 :	:Famagusta. 3 near :misses. Size and :type not known.	:	
SELKIRK Minesweeper 1917-19	:Aug. 8, 1941 :	:Near miss. Size :and type unknown.	:Nil.	
BLACK SWAN Escort Type Sloop 1939	:Aug. 24, 1941 :	:Near miss. Size :and type unknown.	:Slight. 3 weeks	•
GANNET Rivergun Boat 1927 .	:Sept. 6, 1940 :	:North Atlantic. :Near miss. Size :and type not known.	:Nil. :	

MISCELLANEOUS CRAFT

River Gunboats and Others.	: Date	:	Attack	:	Remarks	
FRANKLIN Surveying Ship						
1937	:Nov. 13, 19 ^l	O:North	Sea. Near	:N1l.		
	•		50 Kg. D.A.	:		
	•	:fuse.		:		
ALECTO Submarine Depot Ship					,	
1911	:Mar. 27, 191	l :Englia	h Channel.	:Nil.		
	:		hit. D.A.	:		
			Size not	:		
	.	:known.		:		
						<u> </u>
PROTECTOR Netlayer						
1936	:Apr. 22, 191		ay. Near miss	.:Nil.		
	:		nd type not	2		•
		:known.		:		
CORFIELD						
	:May 9, 1941	:Dowein	g. Near miss.	•1717		
	:		nd type not	:		
	:	known.	· ·	•		
LADYBIRD River Gun Boat						
1915	:May 11, 1941		. 2 direct	:Sunk.		
	*		size and type	:		
	:	:not kn	own.	:		
FRANKLIN Surveying Ship		··· -				
1937	:May 13, 1941	L :North	Sea. 4 near	:Nil.		
	:		. Size and	:		
	• • • • • • • • • • • • • • • • • • •		ot known.	:		
	1,1					

River Gunboats and Others.	•	Date	;	Attack	:	Remarks
FRANKLIN Surveying Ship 1937	:June 3, 1941 :		:North Sea. 2 near :misses. 250 Kg. :D.A. fuses.		:Sligh	t. 9 days.
CRICKET River Gunboat 1915	:June :	30, 1941		a Matruh. etails known.	:Total	loss.

MISCELLANEOUS CRAFT

Submar	ines	:	Date	: Attack	:	Remarks
SEAHORSE 640 Tons	1932	:Sept	. 5, 1939	:North Sea. Size not :known. D.A. fuse.	:Slight. 4	
OLYMPUS 1475 Tons	1928	:July :	7, 1940	:Malta Dockyard. Di- :rect hit. Size un- :known. Inst. fuse.	:	4 months.
*ROVER 1475 Tons	1930	:May	24, 1941	:Near miss.	:Repaired	at Singapore.
*REGENT 1475 Tons	1930	:May	26, 1941	:Near miss.	:Slight. 2	weeks.
P-32		:May	5 k , 1941	:	:N11.	
OLYMPUS 1475 Tons	1928	:July : :	31, 1941	:Also depth size and :type unknown :charged.	:Moderate.	10 weeks.
UNIQUE		:Aug.	20, 1941	:	:N11.	

Armed Merchant Cruisers	: Date :	: Attack	: Remarks
WOLFE	: :Sept. 12, 1940 :	: Direct hit. Did: not explode.	: N11.
COMORIN	Apr. 6, 1941	:	: Sunk
Small Motor Craft M.M.S. 18	: :May 11, 1941	: : Near miss.	: Nil.
M.M.S. 1	:May 11, 1941	:Near miss. London:	12 days.
M.G.B. 61	:Mar.10, 1941 :	: Near miss. : Portsmouth :	3 weeks.
M.G.B. 98	:Mar.11, 1941	: Portsmouth :	Sunk.
M.G.B. 63	:July 25, 1941		Nil.
M.G.B. 70	:Aug. 22, 1941		N11.
M.T.B. 50	:May 15, 1941	Near miss.	Severe. 5 months.